

Langlade Co.
Surveyor

Stock No. 26273

Sheet 1 of 5



PLAT OF SURVEY

U.S. GOVERNMENT LANDS

BEING ALL OF SECTION 23 EXCEPT GOVERNMENT LOT 1 AND
PART OF GOVERNMENT LOT 2; SECTION 23, TOWNSHIP 32 NORTH,

RANGE 14 EAST, FOURTH PRINCIPAL MERIDIAN,

LANGLADE COUNTY, WISCONSIN.

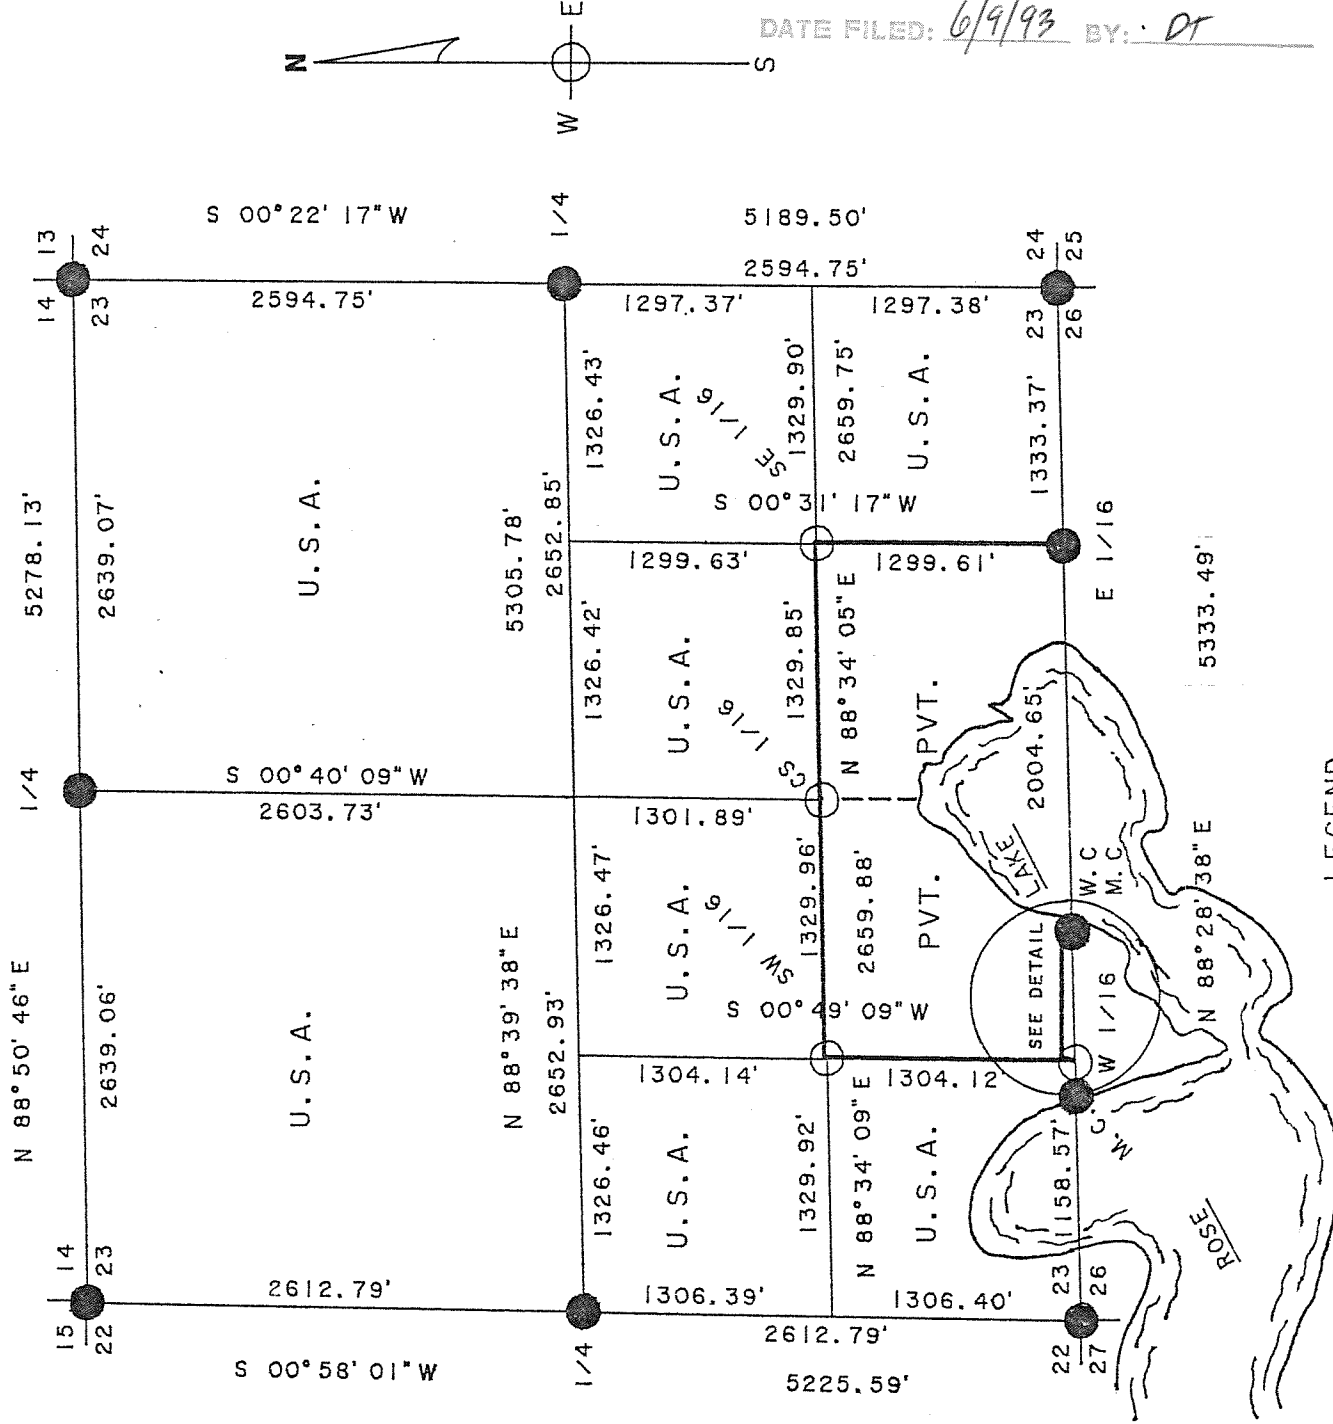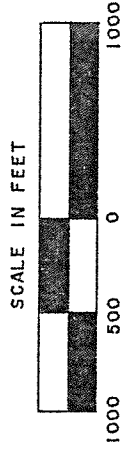

LEGEND


- 2 1/2" ALUMINUM MONUMENT, FOUND IN PLACE.
- 1" x 36" ALUMINUM MONUMENT, SET THIS SURVEY.
- MARKED BOUNDARY LINES OF U.S. GOVERNMENT LANDS.

RECORD # 10138
LANGLADE COUNTY SURVEYORS OFFICE
DATE FILED: 6/9/93 BY: DT

(P)

(P)

DETAIL

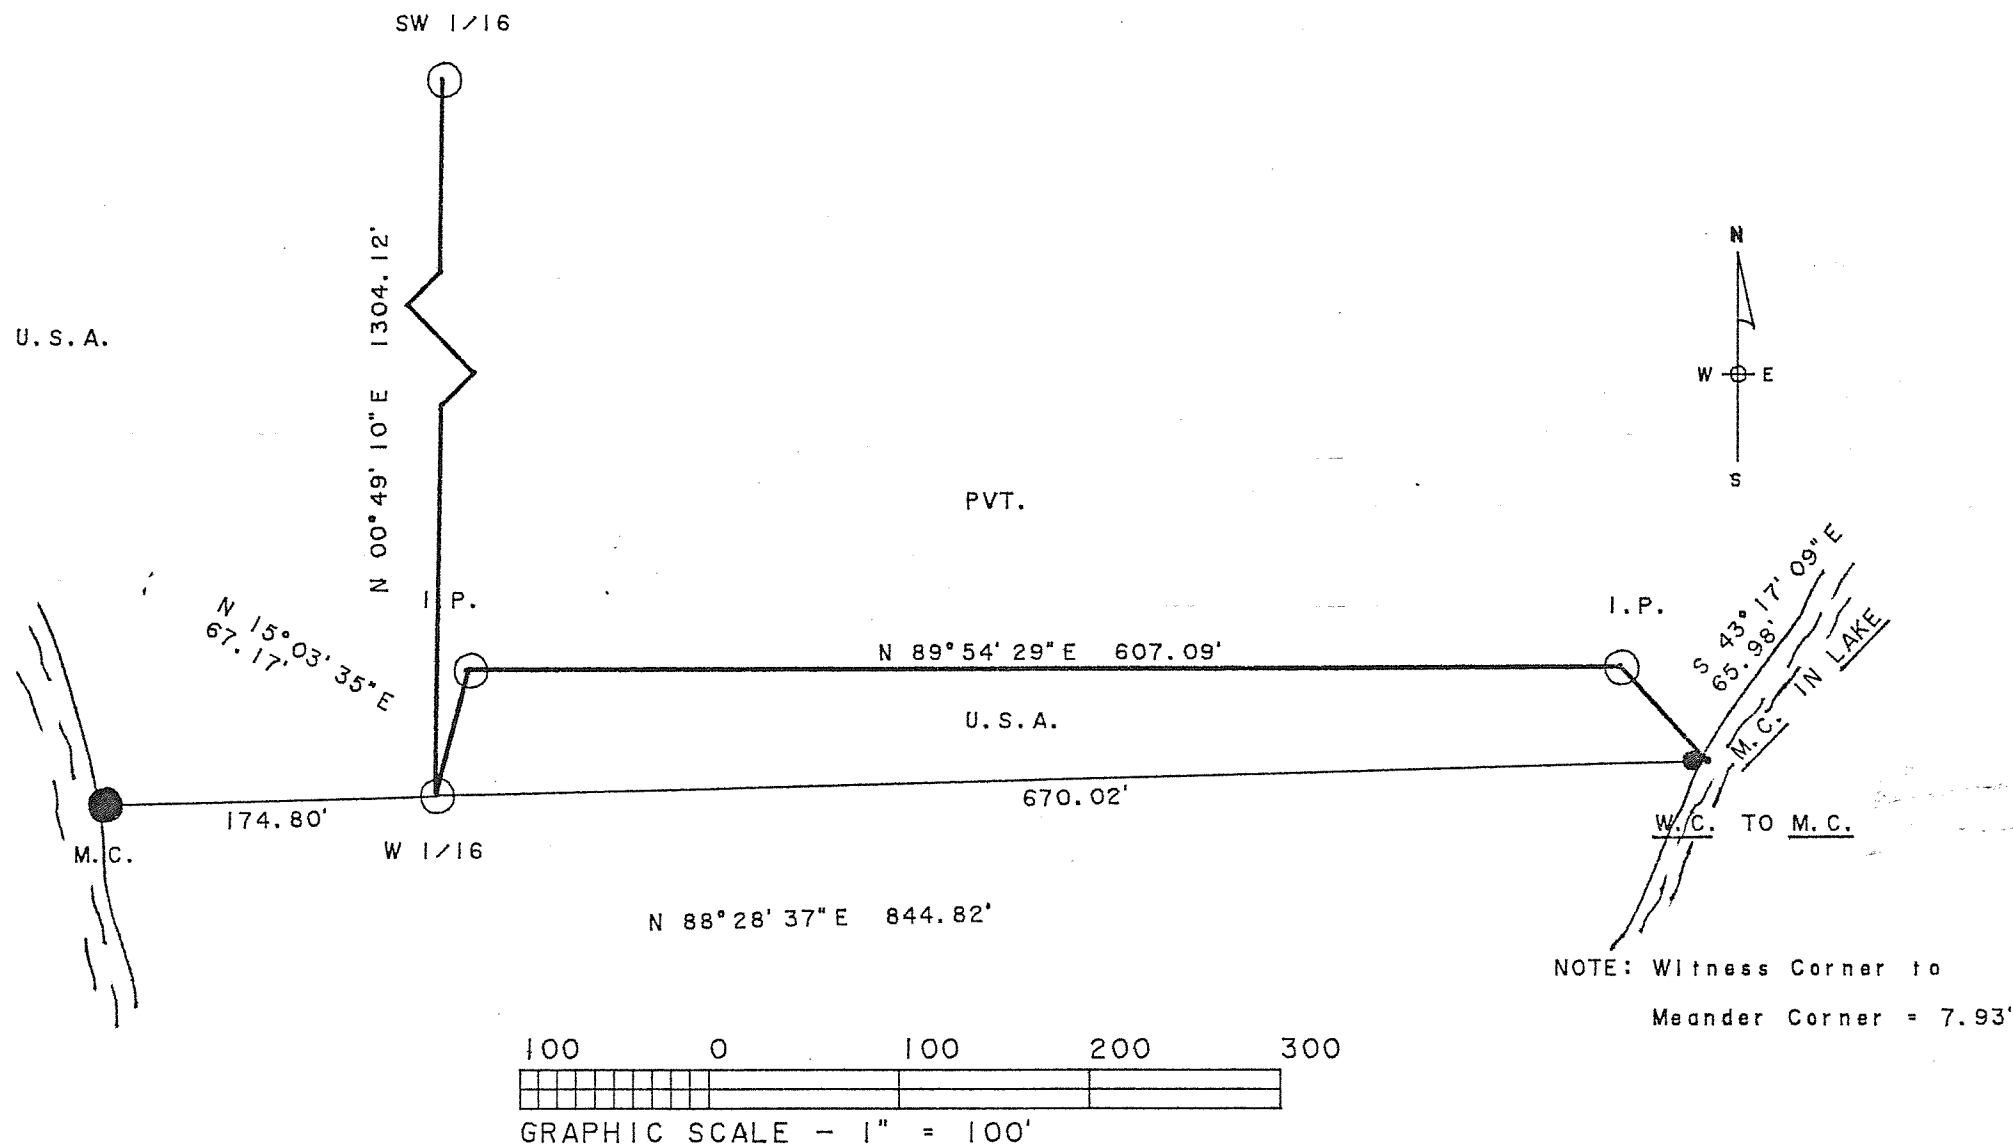

Stock No. 26273

Sheet 3 of 5

SURVEY NOTES

This survey was made by the U. S. Department of Agriculture, Forest Service, for the purpose of restoring and establishing corners on the perimeter of Section 23 for establishing subdivisional corners within Section 23 and for locating and marking the boundaries of U. S. Government land on their perimeter and within Section 23, Township 32 North, Range 14 East, Fourth Principal Meridian, Langlade County, Wisconsin.

The U. S. Government lands in this section were acquired in 1936, 1937, 1945, and 1986.

The original government subdivision survey of this township was made in 1857.

The corner positions recovered, restored, and established by this survey are marked by the monument described in the map legend.

The corner positions established were located to an accuracy of one part in 5000.


The bearings between corner positions are true bearings as determined by solar observations.

The field notes of this survey and a copy of this plat are on file in the Forest Supervisor's Office at Rhinelander, Wisconsin.

CORNERS RECOVERED AND RESTORED

1. Section Corner to Sections 14, 15, 22, and 23.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.
2. Section Corner to Sections 13, 14, 23, and 24.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.
3. Section Corner to Sections 23, 24, 25, and 26.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.
4. Section Corner to Sections 22, 23, 26, and 27.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.
5. Quarter Corner to Sections 14 and 23.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.
6. Quarter Corner to Sections 23 and 24.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.
7. Quarter Corner to Sections 22 and 23.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.
8. Meander Corner West Side Rose Lake to Sections 23 and 26.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.

(7)



Stock No. 26273

Sheet 4 of 5

9. Meander Corner East Side Rose Lake to Sections 23 and 26.
 Corner recovered as set by A. Harrison (RLS), certificate on file in
 Langlade County.

10. East Sixteenth Corner to Sections 23 and 26.
 Corner recovered as set by A. Harrison (RLS), certificate on file in
 Langlade County.

CORNERS ESTABLISHED

1. West Sixteenth to Sections 23 and 26.

Corner position established on line and at one fourth the distance between
 the northwest and northeast section corners of Section 26.
 Corner references:

Sugar	6"	N.09°E.	23.81 feet
Sugar	6"	S.75°E.	33.03 feet
Steel Sign Post		Northwest	0.80 feet

2. Southwest Sixteenth to Section 23.

Corner position established at the intersection of the south and west
 sixteenth lines of Section 23.

Corner references:

Sugar	6"	S.12°W.	12.04 feet
Sugar	7"	N.76°W.	24.61 feet
Steel Sign Post		Northwest	0.80 feet

3. Center South Sixteenth to Section 23.

Corner position established midpoint and on line between the center
 quarter and south quarter corners of Section 23.

Corner references:

Sugar	4"	S.12°E.	46.30 feet
Sugar	6"	S.29°W.	50.60 feet
Iron Pipe	3/4"	S.30°E.	63.71 feet
Steel Sign Post		East	21.63 feet
North Edge			
Blacktop Road		South	2.00 feet


(Note: Corner is set 6" below surface.)

4. Southeast Sixteenth Corner to Section 23.

Corner position established at the intersection of the south and east
 sixteenth lines of Section 23.

Corner references:

Double Sugar	7"	N.37°E.	7.63 feet
Sugar	8"	S.08°W.	29.21 feet
Steel Sign Post		Northeast	0.80 feet



Stock No. 26273

Sheet 5 of 5

SURVEYOR'S AFFIDAVIT

State of Wisconsin]
County of Langlade]

I, Alan D. Harrison, Land Surveyor, U.S.D.A. Forest Service and a Registered Land Surveyor in the State of Wisconsin, do hereby certify that I have surveyed and subdivided Section 23, Township 32 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and the notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for survey of the public lands and with the statutes of the State of Wisconsin.




LAND SURVEYOR, U.S.D.A. FOREST SERVICE
R.L.S. Number S-1651
State of Wisconsin

Plat ready for filing:


District Ranger

Date of Survey: 1990

P/