


Stock No. 26273

SHEET 1 of 4

PLAT OF SURVEY U.S. GOVERNMENT LAND

Being the S1/2; S1/2, NE1/4 & NE1/4, NE1/4 Section 21
Township 32 North, Range 14 East, Fourth Principal Meridian
LANGLADE COUNTY, WISCONSIN

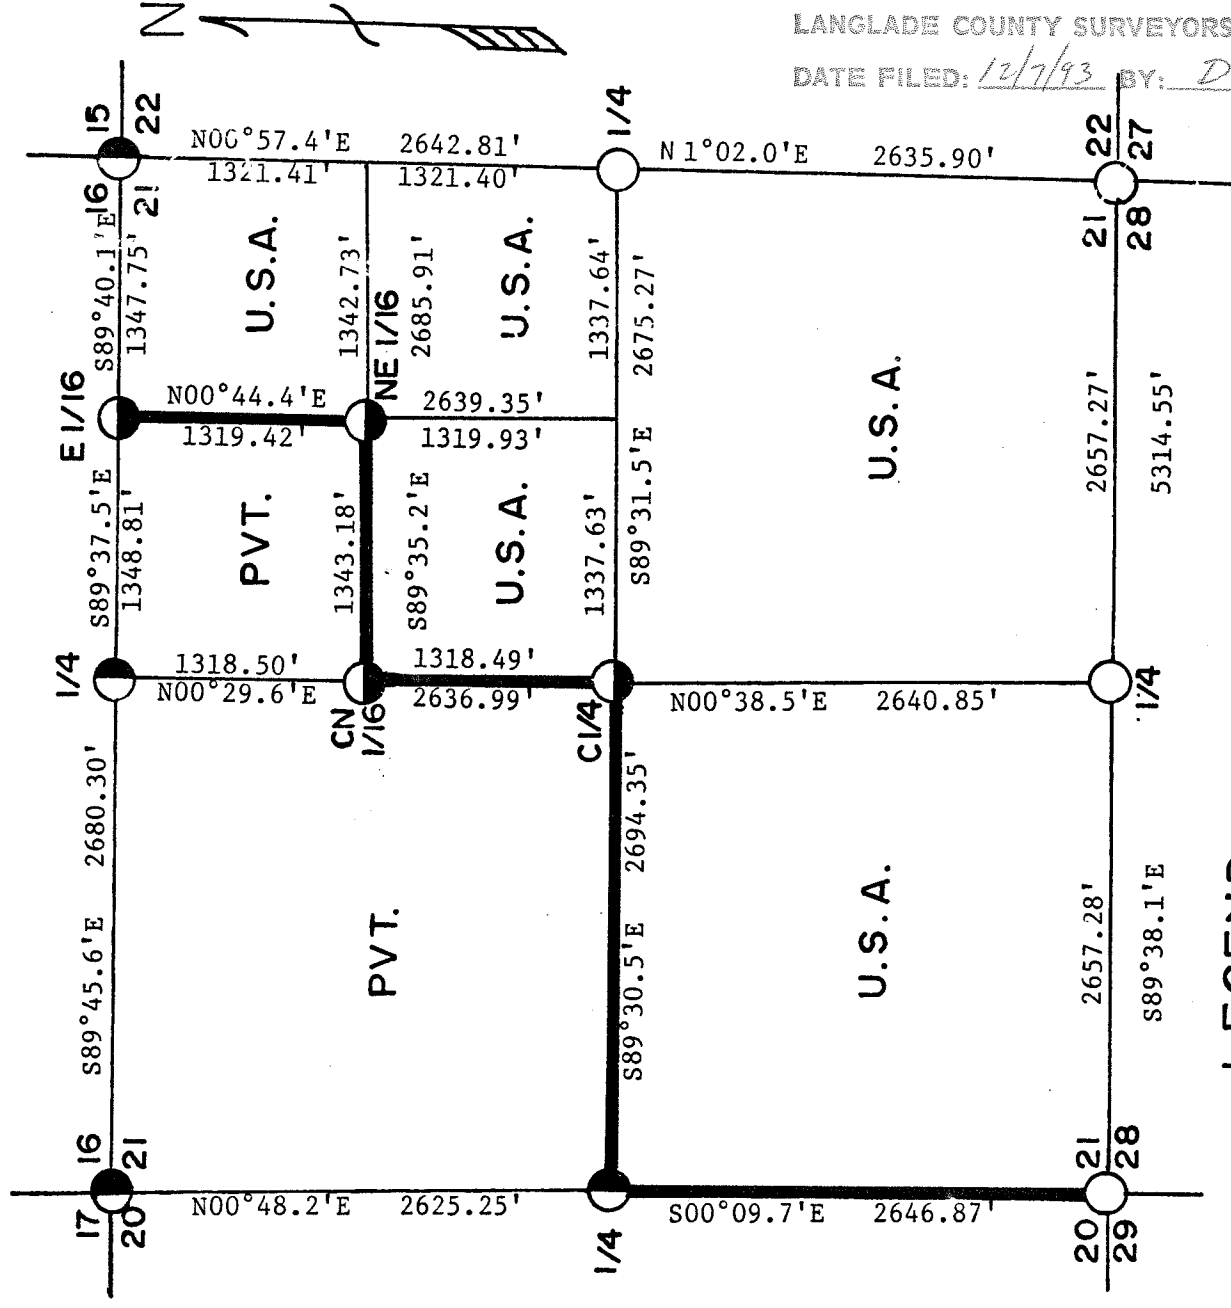

RECORD # 10351
LANGLADE COUNTY SURVEYORS OFFICE
DATE FILED: 12/7/93 BY: D.T.

LEGEND

- Set Forest Service Aluminum Monument 1" x 36"
- Found Langlade County Monument
- Found Forest Service Aluminum Monument
- Boundary U.S. Government Lands

CONVERSION FACTORS:

Meters to Feet - 3.280833
Feet to Meters - .304801

SURVEY NOTES

This survey was made at the request of the U. S. Department of Agriculture, Forest Service, under contract #53-56A6-8-00187 dated June 3, 1988 to Milo E. Stefan, a registered land surveyor in the State of Wisconsin. The purpose of the survey was to subdivide, establish corners and mark the boundaries of U. S. Government Lands on the perimeter and within Section 21, T32N, R14E, Fourth Principal Meridian, Langlade County, Wisconsin as shown on the plat map herewith.

The original government subdivision survey of this Township was done in 1857 by Alfred Millard. The Forest Service provided the control survey for the subdivision of this section. All control corners on the exterior and the Center Quarter Corner to this survey were furnished by the Forest Service.

The Forest Service, U. S. Department of Agriculture, acquired ownership to these lands in this section between 1935 to 1946. Bearings for this survey have been provided by the control survey in 1987. True bearings and distances have been provided by the contractor. The field survey notes and a copy of this plat of survey are on file in the Forest Supervisor's Office of the Nicolet National Forest in Rhineland, Wisconsin. A copy of the plat of survey is also on file in the District Ranger's Office in Lakewood, Wisconsin.

CORNERS RECOVERED AND RESTORED

1. Section Corner Common to Sections 16, 17, 20 and 21; T32N, R14E.
 Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
2. Section Corner Common to Sections 15, 16, 21 and 22; T32N, R14E.
 Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
3. Section Corner Common to Sections 20, 21, 28 and 29; T32N, R14E.
 Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
4. Section Corner Common to Sections 21, 22, 27 and 28; T32N, R14E.
 Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
5. Quarter Corner to Sections 16 and 21; T32N, R14E.
 Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
6. Quarter Corner to Sections 20 and 21; T32N, R14E.
 Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
7. Quarter Corner to Sections 21 and 22; T32N, R14E.
 Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
8. Quarter Corner to Sections 21 and 28; T32N, R14E.
 Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.

P-11 9.

Center Quarter Corner to Section 21.

Acceptable position found marked by a 1" iron pipe from past surveys. Restored position by placement of a Forest Service drive type 1" x 36" aluminum rod with tablet stamped to identify the corner.

Corner references:

3"	Red Oak	N24°W	3.63 Feet
8"	Red Maple	N48°E	21.92 Feet
	Steel Sign Post	North	1.5 Feet
	Mound of Rock Around Monument		

N-12 10.

East Sixteenth Corner to Sections 16 and 21.

Acceptable position found marked by a 1" iron pipe. Restored position by placement of a Forest Service drive type 1" x 36" aluminum rod with tablet stamped to identify the corner.

Corner references:

7"	Ironwood	N63°E	12.50 Feet
10"	Basswood	N75°W	16.52 Feet
	Steel Sign Post	South	1.2 Feet
	Center Line of Road	South	34.5 Feet
	1" Iron Pipe	South	13.6 Feet

CORNERS ESTABLISHED

O-11 1.

Center North Sixteenth Corner to Section 21.

Corner position established on line and at midpoint between the North Quarter and Center Quarter Corners to Section 21. Position marked by a 1" x 36" drive type aluminum monument with tablet stamped to identify the corner.

Corner references:

8"	Red Oak	S33°E	26.29 Feet
12"	Basswood	S24°W	25.41 Feet
	Steel Sign Post	South	1.1 Feet
	Steel Pipe	S23°E	3.6 Feet

P-12 2.

Northeast Sixteenth Corner to Section 21.

Corner position established at the intersection of the East and North Sixteenth lines to Section 21. Position marked by a 1" x 36" drive type aluminum monument with tablet stamped to identify the corner.

Corner references:

10"	White Ash	S19°E	11.54 Feet
4"	Basswood	S58°W	28.08 Feet
	Steel Sign Post	North	1.0 Feet
	Local Corner, A	S62°E	6.0 Feet
	Spring Leaf		

SURVEYOR'S AFFIDAVIT

State of Wisconsin) ss
County of Langlade)

I, Milo E. Stefan, a Registered Land Surveyor in the State of Wisconsin, hereby certify that I have surveyed and marked the boundaries to Forest Service Lands in Section 21, Township 32 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and survey notes herein are a correct representation of the land surveyed and boundaries marked. I have surveyed and posted the boundaries in said sections in accordance with the rules for survey of the public lands and with the statutes of the State of Wisconsin.

Date of Survey: June 1988


Milo E. Stefan
Registered Land Surveyor S-1558
State of Wisconsin



Plat Ready for Filing: 8/4/88 Date


District Ranger