
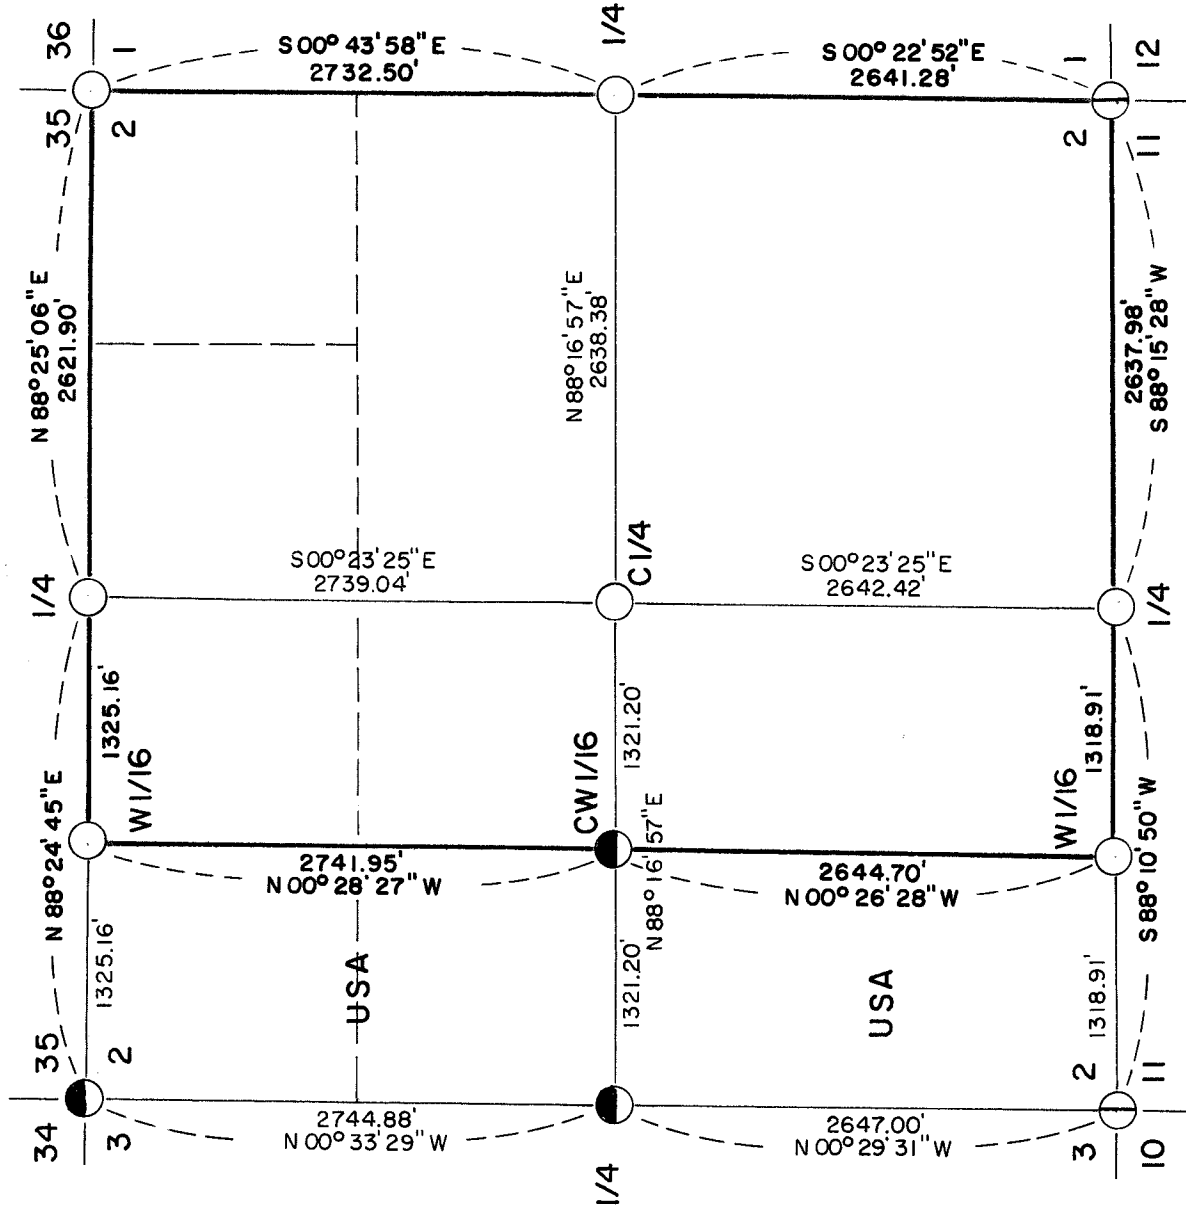


Stock No. 26273

Sheet one of five

PLAT OF SURVEY U.S. GOVERNMENT LAND

Being W1/2-NW1/4 and W1/2-SW1/4 all in Section 2
Township 32 North, Range 14 East, Fourth Principal Meridian
LANGLADE COUNTY, WISCONSIN

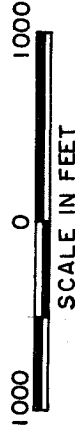

LEGEND

- 2" Diameter Aluminum monument 60" long
- 2" Diameter Aluminum monument 30" long
- ⊙ Existing 2" Diameter Aluminum monument

— Marked Boundary Lines of U.S., Government Lands

CONVERSION FACTOR:

Feet to Meters = 0.304801

Meters to Feet = 3.280833

RECORD # 10356

LANGLADE COUNTY SURVEYORS OFFICE

DATE FILED: 12/7/93 BY: D.T.

Stock No. 26273

Sheet two of five

SURVEY NOTES

This survey was made by AARON ASSOCIATES of Oconto Falls, Wisconsin under contract with the U.S. Department of Agriculture, Forest Service, for the purpose of restoring and establishing corners of the perimeter of Section 2, for establishing subdivisional corners within Section 2, and for locating and marking the boundaries of U.S. Government lands on their perimeter and within Section 2, Township 32 North, Range 14 East, Fourth Principal Meridian, Langlade County, Wisconsin.

The US Government Lands were acquired in the mid 1930s with additional acquisitions in 1971.

The original government survey of this township was made in 1857.

The corner positions recovered, restored, and established by this survey are marked by monuments described in the map legend.

The corner positions established were located to an accuracy of one part in 10,000.

The bearings between corner positions are true bearings as determined by solar observation.

The field notes and a copy of this Plat and survey are on file in the Forest Supervisor's Office at Rhinelander, Wisconsin.

CORNERS RECOVERED AND RESTORED

- A-17 1. Corner to Sections 34 and 35 of T33N, R14E and Sections 2 and 3 of T32N, R14E.

This corner position was restored from original evidence of stumps of the original bearing trees. A large white pine stump was found S 37 W and 23 feet from corner position. A Hemlock stump hole was located N 58 W 32 feet and a Tamarack stump N 65 E 32 feet was located. Swamp calls to the east of 33 feet and 330 feet fit well. Area was flooded by beaver activity and post was not located. I set this corner on the basis of found bearing tree evidence.

Corner references:

Sugar	8"	N 70 W	69.12'
Sugar	12"	N 46 W	50.41'
Sugar	10"	N 20 W	81.51'
Sugar	10"	N 03 W	72.93'
7' Steel Sign Post		S 41 E	1.10'

- A-21 2. Corner to Sections 35 and 36, T33N, R14E and Sections 1 and 2, T32N, R14E.

This corner position was recovered from the original bearing tree stumps of the government survey. I found the rotted remains of the two Hemlock stumps S 55 E, 30 feet and S 55 W, 8 feet. Yellow Birch stump remains were located N 14 E, 40 feet and a hardwood stump hole N 20 W 43 feet was also found. In addition the Hemlock line tree to the East, 184.8' was also found. The corner was located near a blazed Sugar. I therefore set this corner from these stump positions.

Corner references:

Hemlock	10"	N 14 W	42.75'
Sugar	18"	S 26 E	48.90'
Hemlock	4"	S 34 W	44.74'
Sugar	20"	N 51 W	18.75'
7' Steel Sign Post		N 84 E	1.00'

Stock No. 26273

Sheet three of five

E-21 3. Corner to Sections 1-2-11-12, T32N, R14E.

Located a 2" Aluminum monument set by Milo Stefan, RLS in 1984.
Corner certificate on file.

Corner references:

Sugar Maple	8"	N 42 E	57.18'
Sugar Maple	6"	S 18 E	22.90'
Basswood	10"	S 60 W	36.32'
Sugar Maple	6"	N 52 W	29.42'
7' Steel Sign Post		West	3.70'

E-17 4. Corner to Sections 2-3-10-11, T32N, R14E.

Located a 2" Aluminum monument with cap stamped for corner set by Milo Stefan, RLS. Certificate on file.

Corner references:

Basswood	7"	N 82 E	63.52'
White Spruce	9"	S 02 W	26.27'
Basswood	4"	N 79 W	12.89'
White Birch	8"	N 13 W	38.06'
7' Steel Sign Post		Southwest	1.10'

A-19 5. Quarter corner to Sections 35, T33N, R14E and 2, T32N, R14E.

At this corner location I found a Hemlock stump bearing N 75 W and 30' from corner position. Another Hemlock stump was found at the S 12 E and 40' area. The original bearing trees were Hemlocks of 12" and 18" diameters at these bearings and distances. I monumented this corner from these Hemlock stumps which corner was further verified by a hardwood stump hole 162 feet East, a possible Sugar line tree 2 1/4" diameter.

Corner references:

Sugar Maple	5"	N 84 E	25.30'
Sugar Maple	12"	S 08 W	30.14'
Yellow Birch	8"	S 75 W	76.94'
Yellow Birch	6"	N 41 W	21.00'
7' Steel Sign Post		N 06 E	0.91'

C-21 6. Quarter corner to Sections 1 and 2, T32N, R14E.

Located a 1 1/4" iron pipe surrounded by blazed Basswood trees. The iron pipe fit a blazed line to the south. No evidence of the two Lynn bearing trees was found. I accepted the iron pipe as perpetuation of the corner.

Corner references:

Sugar Maple	10"	N 18 E	13.80'
Sugar Maple	12"	N 82 E	64.53'
Sugar Maple	8"	S 16 E	11.44'
Sugar Maple	12"	N 83 W	57.54'
7' Steel Sign Post		S 84 E	1.00'

Stock No. 26273

Sheet four of five

E-19 7. Quarter corner to Sections 2 and 11, T32N, R14E.

Located remains of a 4" cedar post in a pile of Granite rock. N 11 W and 14.5' I found a Yellow Birch stump which fit the original Bearing tree call. The 14" Hemlock line tree 531.30' East was also found and fit the wood post position.

Corner references:

Red Maple	7"	S 83 W	10.83'
Red Maple	6"	N 15 E	7.94'
Red Maple	4"	S 54 E	14.93'
Ironwood	7"	S 02 E	23.28'
7' Steel Sign Post		S 39 E	2.90'

C-17 8. Quarter corner to Sections 2 and 3, T32N, R14E.

A 12" Cedar N 64 E, 3.96' and a 6" Cedar South 9.24' were the original Bearing trees. Within a couple of feet of the single proportionate position for this corner, I found the stumps of Cedar trees at these bearing tree locations. The Cedar line tree to the north was also located helping to support this position.

Corner references:

White Birch	8"	N 43 E	43.71'
White Birch	8"	N 74 E	14.48'
Ash	6"	S 05 E	17.03'
White Birch	6"	N 64 W	38.88'
8' Steel Sign Post		North	1.20'

CORNERS ESTABLISHED**C-19 9. Center quarter corner of Section 2, T32N, R14E.**

I Set this corner position at the intersection point of the north-south and east-west quarter lines. No occupation in the area was notes.

Corner references:

Tamarack	5"	S 08 E	15.20'
Cherry	10"	S 75 E	115.80'
7' Steel Sign Post		North	1.35'
7' Steel Sign Post		West	1.40'

A-18 10. West sixteenth corner between Sections 35, T33N, R14E and 2, T32N, R14E.

I set this corner at midpoint between the North quarter and Northwest corners of said Section 2.

Corner references:

Sugar Maple	5"	S 61 E	25.85'
Sugar Maple	10"	S 60 W	4.65'
Sugar Maple	6"	N 16 W	17.86'
7' Steel Sign Post		North	1.10'

C-18 11. Center west sixteenth corner of Section 2, T32N, R14E.

I set this corner on the east-west quarter line of Section 2 midway between the $W\frac{1}{4}$ and $C\frac{1}{4}$ corners of said Section 2.

Corner references:

Red Maple	4"	S 40 E	58.22'
Red Maple	6"	S 02 E	129.10'
Yellow Birch	6"	N 65 W	61.72'
7' Steel Sign Post		S 27 W	1.00'

Stock No. 26273

E-18

12. West sixteenth corner between Sections 2 and 11, T32N, R14E.

Sheet five of five

I set this corner at midpoint between the Southwest and South quarter corners of said Section 2.

Corner references:


Yellow Birch (dbl)	10"	S 63 E	47.91'
Yellow Birch	10"	S 11 E	43.35'
Sugar Maple	10"	N 55 W	2.72'
7' Steel Sign Post		North	2.26'

SURVEYOR'S AFFIDAVIT

STATE OF WISCONSIN)
OCONTO COUNTY)SS


I, Kim H Pritzlaff, Registered Land Surveyor in the State of Wisconsin, hereby certify: that I have surveyed and subdivided Section 2, Township 32 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.


The Plat map and notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules of survey of the public lands and with the Statutes of the State of Wisconsin.

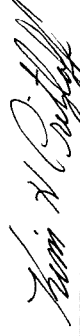

Kim H Pritzlaff, RLS No. 1259
AARON ASSOCIATES
Oconto Falls, Wisconsin

Date of survey: 1985

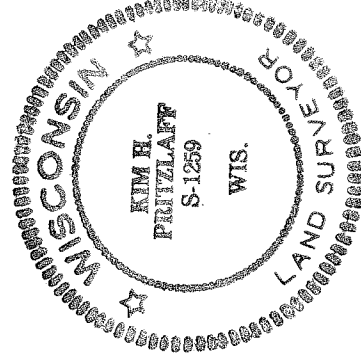

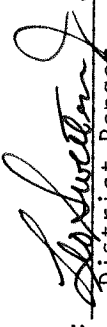Plat ready for filing: 

District Ranger