


James A. Duffield

PLAT OF SURVEY

BEING THE S. 1/2; THE E. 1/2 OF THE N.E. 1/4; GOVERNMENT LOT 1;
GOVERNMENT LOT 2; AND GOVERNMENT LOT 5; SECTION 26, TOWNSHIP
32 NORTH, RANGE 14 EAST, FOURTH PRINCIPAL MERIDIAN,
LANGLADE COUNTY, WISCONSIN.

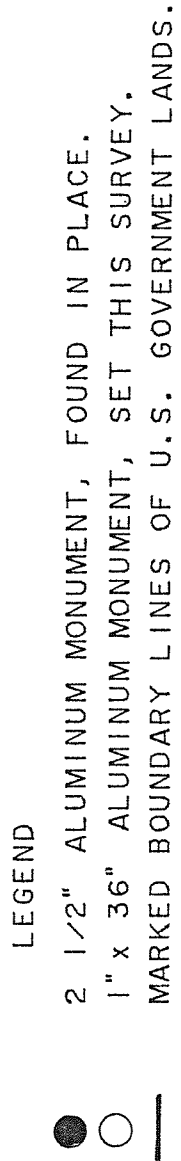

RECORD # 10134
LANGLADE COUNTY SURVEYORS OFFICE
DATE FILED: 6/9/93 BY: DT.



Stock No. 26273

Sheet 2 of 4

SURVEY NOTES

This survey was made by the U.S. Department of Agriculture, Forest Service, for the purpose of restoring and establishing corners on the perimeter of Section 26 for establishing subdivisional corners within Section 26 and for locating and marking the boundaries of U.S. Government land on the perimeter and within Section 26, Township 32 North, Range 14 East, Fourth Principal Meridian, Langlade County, Wisconsin.

The U.S. Government lands in this section were acquired in 1934, 1935, and 1986.

The original government subdivision survey of this township was made in 1857.

The corner positions recovered, restored and established by this survey are marked by the monument described in the map legend.

The corner positions established were located to an accuracy of one part in 5000.

The bearings between corner positions are true bearings as determined by solar observations.

The field notes of this survey and a copy of this plat are on file in the Forest Supervisor's Office at Rhineland, Wisconsin.

CORNERS RECOVERED AND RESTORED

1. Section Corner to Sections 22, 23, 26, and 27.
Corner recovered as set by A. Harrison, R.L.S., certificate on file in Langlade County.
2. Section Corner to Sections 23, 24, 25, and 26.
Corner recovered as set by A. Harrison, R.L.S., certificate on file in Langlade County.
3. Section Corner to Sections 25, 26, 35, and 36.
Corner recovered as set by A. Harrison, R.L.S., certificate on file in Langlade County.
4. Section Corner to Sections 26, 27, 34, and 35.
Corner recovered as set by A. Harrison, R.L.S., certificate on file in Langlade County.
5. Quarter Corner to Sections 25 and 26.
Corner recovered as set by A. Harrison, R.L.S., certificate on file in Langlade County.
6. Quarter Corner to Sections 26 and 35.
Corner recovered as set by A. Harrison, R.L.S., certificate on file in Langlade County.
7. Quarter Corner to Sections 26 and 27.
Corner recovered as set by A. Harrison, R.L.S., certificate on file in Langlade County.
8. Meander Corner West Side Rose Lake to Sections 23 and 26.
Corner recovered as set by A. Harrison, R.L.S., certificate on file in Langlade County.



Stock No. 26273

Sheet 3 of 4

9. Meander Corner East Side Rose Lake to Sections 23 and 26.
 Corner recovered as set by A. Harrison, R.L.S., certificate on file in
 Langlade County.

10. East Sixteenth Corner to Sections 23 and 26.
 Corner recovered as set by A. Harrison, R.L.S., certificate on file in
 Langlade County.

CORNERS ESTABLISHED

1. Center Quarter Corner to Section 26.
 Corner position established at the intersection of the east-west quarter
 line and the mean bearing from the south quarter corner of section 26.
 Corner References:

Basswood	13"	N.28°E.	14.64 feet
Sugar	6"	S.49°E.	32.71 feet
Steel Sign Post		West	1.41 feet

2. Center East Sixteenth Corner to Section 26.
 Corner position established midpoint and on line between the center
 quarter and east quarter corners of section 26.

Corner References:

Sugar	16"	S.16°E.	20.31 feet
Sugar	12"	N.51°W.	21.85 feet
Steel Sign Post		Southeast	1.10 feet

3. Center West Sixteenth Corner to Section 26.
 Corner position established midpoint and on line between the center
 quarter and west quarter corners of section 26.

Corner References:

Sugar	4"	N.30°E.	15.84 feet
Sugar	4"	S.56°W.	18.10 feet
Steel Sign Post		Southwest	1.05 feet

4. Special Meander Corner to Section 26.
 Corner position established at the intersection of the south shore of
 Rose Lake and the west sixteenth line of section 26.


Corner References:

Aspen	10"	S.24°E.	21.49 feet
Red Maple	4"	S.57°W.	17.67 feet
Steel Sign Post		South	0.88 feet

5. West Sixteenth to Sections 23 and 26.
 Corner position established on line and at one fourth the distance
 between the northwest and northeast section corners of section 26.

Corner References:

Sugar	6"	N.09°E.	23.81 feet
Sugar	6"	S.75°E.	33.03 feet
Steel Sign Post		Northwest	0.80 feet



Stock No. 26273


Sheet 4 of 4

SURVEYOR'S AFFIDAVIT

State of Wisconsin]
County of Langlade]

I, Alan D. Harrison, Land Surveyor, U.S.D.A. Forest Service and a Registered Land Surveyor in the State of Wisconsin, do hereby certify that I have surveyed and subdivided Section 26, Township 32 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and the notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for survey of the public lands and with the statutes of the State of Wisconsin.

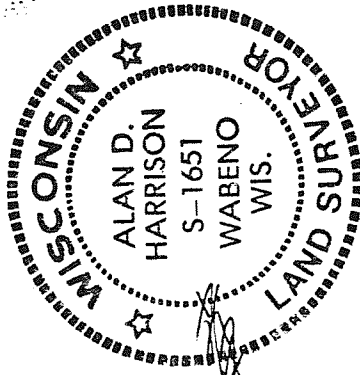


LAND SURVEYOR, U.S.D.A. Forest Service
R.L.S. Number S-1651
State of Wisconsin

Plat ready for filing:


District Ranger

Date of Survey: 1990