



Stock No. 26273

Sheet 1 of 4


PLAT OF SURVEY

U.S. GOVERNMENT LANDS

BEING THE SE 1/4, NE 1/4; THE E 1/2, SE 1/4; GOVERNMENT LOT 3;
AND THE NW 1/4, NW 1/4; SECTION 16, TOWNSHIP 32 NORTH, RANGE 14 EAST,
FOURTH PRICIPAL MERIDIAN, 1989

LANGLADE COUNTY, WISCONSIN.

SCALE IN FEET

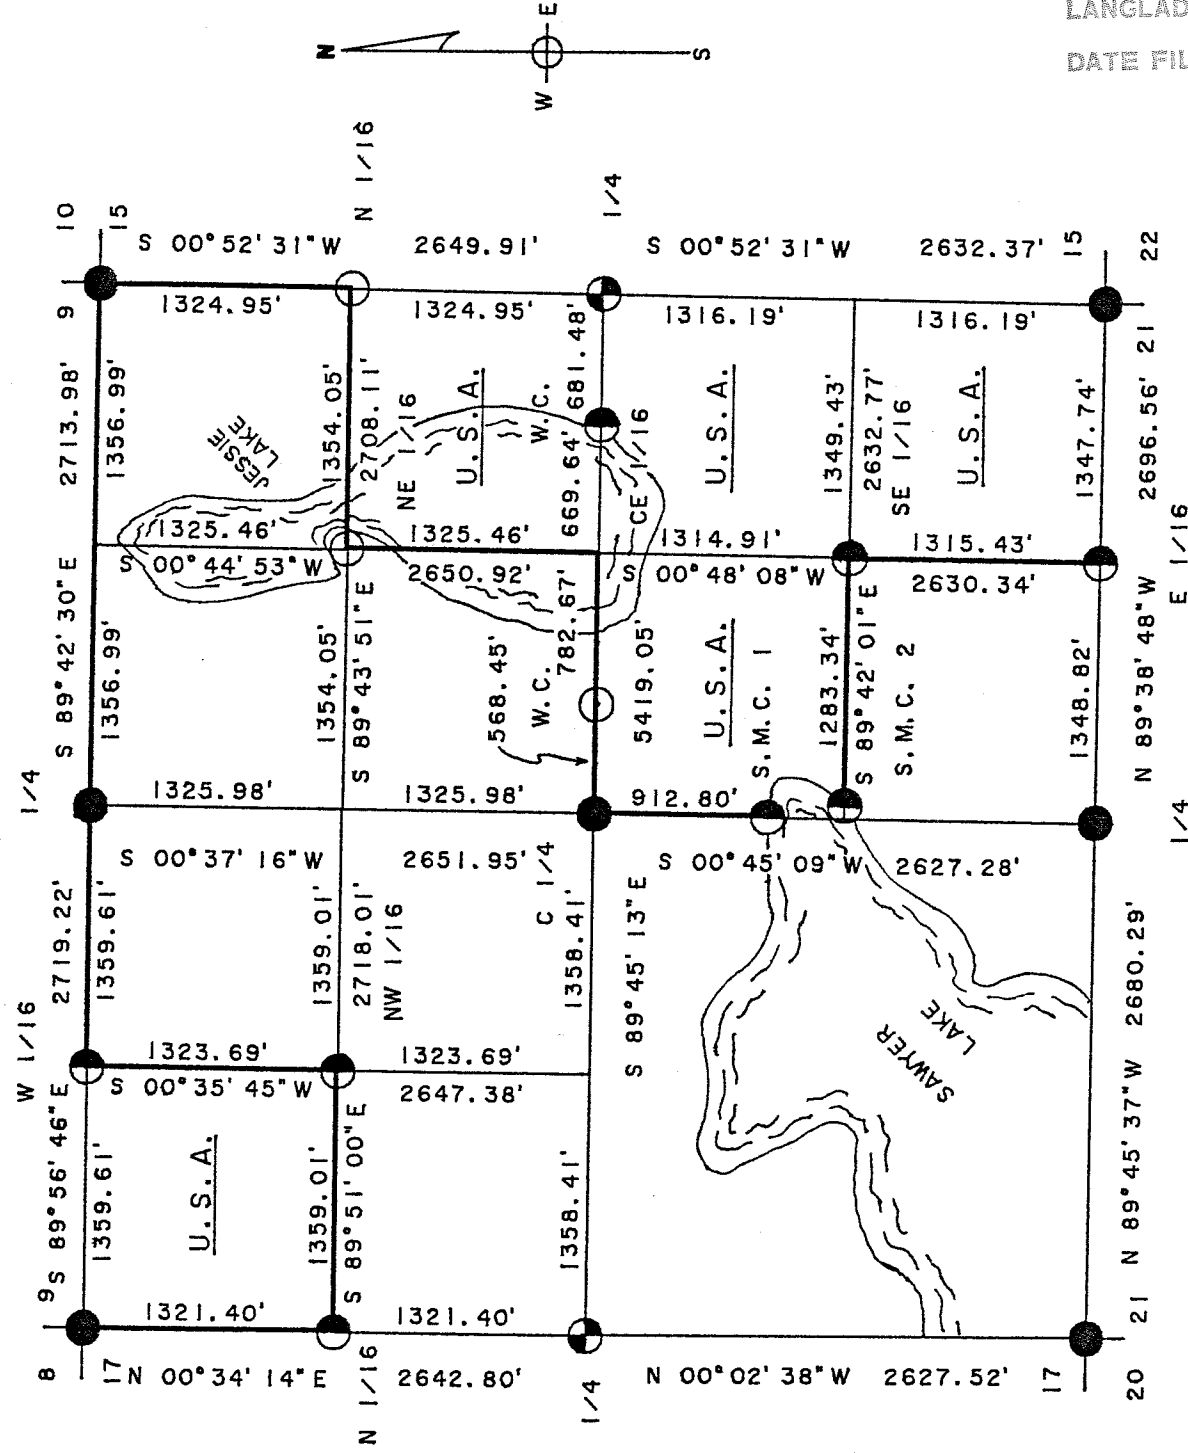

LEGEND

- LANGLADE COUNTY MONUMENT, FOUND IN PLACE.
- ◐ 2 1/2" X 36" ALUMINUM MONUMENT, SET THIS SURVEY.
- ◑ 1" X 36" ALUMINUM MONUMENT, SET THIS SURVEY.
- 1" X 60" ALUMINUM MONUMENT, SET THIS SURVEY.
- MARKED BOUNDARY LINE OF U.S. GOVERNMENT LANDS.

RECORD # 10352
LANGLADE COUNTY SURVEYORS OFFICE
DATE FILED: 12/7/93 BY: DT.



Stock No. 26273

Sheet 2 of 4

SURVEY NOTES

This survey was made by the U. S. Department of Agriculture, Forest Service, for the purpose of restoring and establishing corners on the perimeter of Section 16 for establishing subdivisional corners within Section 16 and for locating and marking the boundaries of U. S. Government land on the perimeter and within Section 16, Township 32 North, Range 14 East, Fourth Principal Meridian, Langlade County, Wisconsin.

The U. S. Government lands in this section were acquired in 1933, 1935, 1946 and 1947.

The original government subdivision survey of this township was made in 1857.

The corner positions recovered, restored and established by this survey are marked by the monument described in the map legend.

The corner positions established were located to an accuracy of one part in 3000.

The bearings between corner positions are true bearings as determined by solar observations.

The field notes of this survey and a copy of this plat are on file in the Forest Supervisor's Office at Rhineland, Wisconsin.

CORNERS RECOVERED AND RESTORED

1. Section Corner to Sections 8, 9, 16, and 17.
Corner recovered as set by R. Hallisy (RLS), certificate on file in Langlade County.
2. Section Corner to Sections 9, 10, 15, and 16.
Corner recovered as set by W. Kelly (RLS), certificate on file in Langlade County.
3. Section Corner to Sections 15, 16, 21, and 22.
Corner recovered as set by W. Kelly (RLS), certificate on file in Langlade County.
4. Section Corner to Sections 16, 17, 20, and 21.
Corner recovered as set by W. Dobbratz (RLS), certificate on file in Langlade County.
5. Quarter Corner to Sections 9, and 16.
Corner recovered as set by D. Pleoeger (RLS), certificate on file in Langlade County.
6. Quarter Corner to Sections 15 and 16.
Corner position restored by prolonging the line from the West quarter corner through the Center quarter corner and at the intersection of the East section line. Certificate on file in Langlade County.
7. Quarter Corner to Sections 16 and 21.
Corner recovered as set by W. Kelly (RLS), certificate on file in Langlade County.
8. Quarter Corner to Sections 16 and 17.
Corner recovered as set by A. Harrison (RLS), certificate on file in Langlade County.
9. Center Quarter Corner of Section 16.
Corner recovered as set by D. Pleoeger (RLS), certificate on file in Langlade County.



Stock No. 26273

Sheet 3 of 4

10. East Sixteenth Corner to Sections 16 and 21.
 Corner recovered as set by M. Stefan (RLS).
 Corner References:

Ironwood	7"	N.63°E.	12.50 feet
Iron Pipe	1"	South	13.60 feet
E Road		South	34.50 feet
Basswood	10"	N.75°W.	16.52 feet
Steel Sign Post		South	1.20 feet

CORNERS ESTABLISHED

1. West Sixteenth Corner to Sections 9 and 16.
 Position established midpoint and on line between the northwest section corner and the north quarter corner of section 16.
 Corner References:

Sugar	11"	N.56°E.	35.80 feet
Sugar	5"	S.11°E.	10.97 feet
Sugar	8"	N.60°W.	20.86 feet
Steel Sign Post		Northwest	0.82 feet
Iron Pipe	2"	West	0.95 feet

2. North Sixteenth Corner to Sections 15 and 16.
 Position established midpoint and on line between the northeast section corner and the east quarter corner of section 16.
 Corner References:

Spruce	6"	N.29°E.	7.81 feet
Spruce	12"	N.67°W.	30.63 feet
Steel Sign Post		Southeast	0.72 feet

3. North Sixteenth Corner to Sections 16 and 17.
 Position established midpoint and on line between the northwest section corner and the west quarter corner of section 16.
 Corner References:


Basswood	7"	S.40°W.	7.66 feet
Sugar	4"	N.49°W.	44.45 feet
Steel Sign Post		East	1.35 feet

4. Northwest Sixteenth Corner to Section 16.
 Position established at the intersection of the north and west sixteenth lines of section 16.
 Corner References:

Sugar	7"	S.15°W.	21.23 feet
Double Oak	9"	N.47°W.	22.22 feet
Steel Monument		Southwest	1.95 feet
Steel Sign Post		Northwest	1.03 feet

5. Northeast Sixteenth Corner to Section 16.
 Position established at the intersection of the north and east sixteenth line of section 16.
 Corner References:

Tamarack	8"	S.67°E.	8.26 feet
Tamarack	9"	S.29°W.	19.42 feet
Steel Sign Post		Southeast	1.27 feet

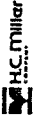

Stock No. 26273

Sheet 4 of 4

M-12 6. Southeast Sixteenth Corner to Section 16.

Position established at the intersection of the south and east sixteenth lines of section 16.

Corner References:

Sugar	4"	S.10°W.	28.73 feet
White Birch	11"	N.72°W.	15.59 feet
Steel Sign Post		Northeast	0.70 feet

M-12 7. Center East Sixteenth Corner to Section 16.

Position established midpoint and on line between the center quarter and east quarter corners of section 16. Corner position falls in Jessie Lake thus we set two witness corners.

Corner References:

Witness Corner	1" x 60"	West	782.67 feet
Witness Corner	1" x 36"	East	681.48 feet

8. Special Meander Corner #1 to Section 16.

Position established on line between the center quarter and south quarter corners of the intersection of the north shore of Sawyer Lake of Section 16.

Corner References:

Oak	4"	N.69°E.	24.00 feet
Oak	14"	N.05°W.	7.88 feet
Steel Sign Post		North	0.82 feet

9. Special Meander Corner #2 to Section 16.

Position established at the intersection of the east shore of Sawyer Lake and on the south sixteenth line of section 16.

Corner Reference:


Cedar	4"	N.42°E.	5.62 feet
Hemlock	14"	S.15°W.	51.17 feet
Steel Sign Post		East	1.18 feet

SURVEYOR'S AFFIDAVIT

State of Wisconsin] SS
County of Langlade]

I, Alan D. Harrison, Land Surveyor, U.S.D.A. Forest Service and a Registered Land Surveyor in the State of Wisconsin, do hereby certify that I have surveyed and subdivided Section 16, Township 32 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and the notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for survey of the public lands and with the statutes of the State of Wisconsin.

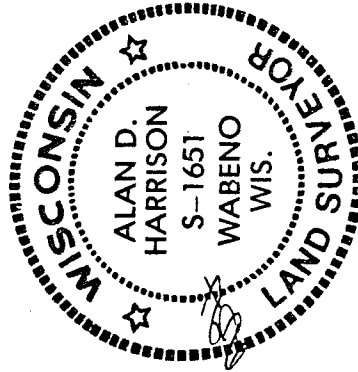

Alan D. Harrison
LAND SURVEYOR, U.S.D.A. Forest Service
R.L.S. Number S-1651
State of Wisconsin

Plat ready for filing:

Date of Survey: 1989

Raymond J. [Signature]
District Ranger