

Stock No. 26273



Langlade County
Surveyor

SHEET 1 of 4

PLAT OF SURVEY U. S. GOVERNMENT LAND

Being the E1/2, & E1/2W1/2 Section 35
Township 32 North, Range 14 East, Fourth Principal Meridian

LANGLADE COUNTY, WISCONSIN

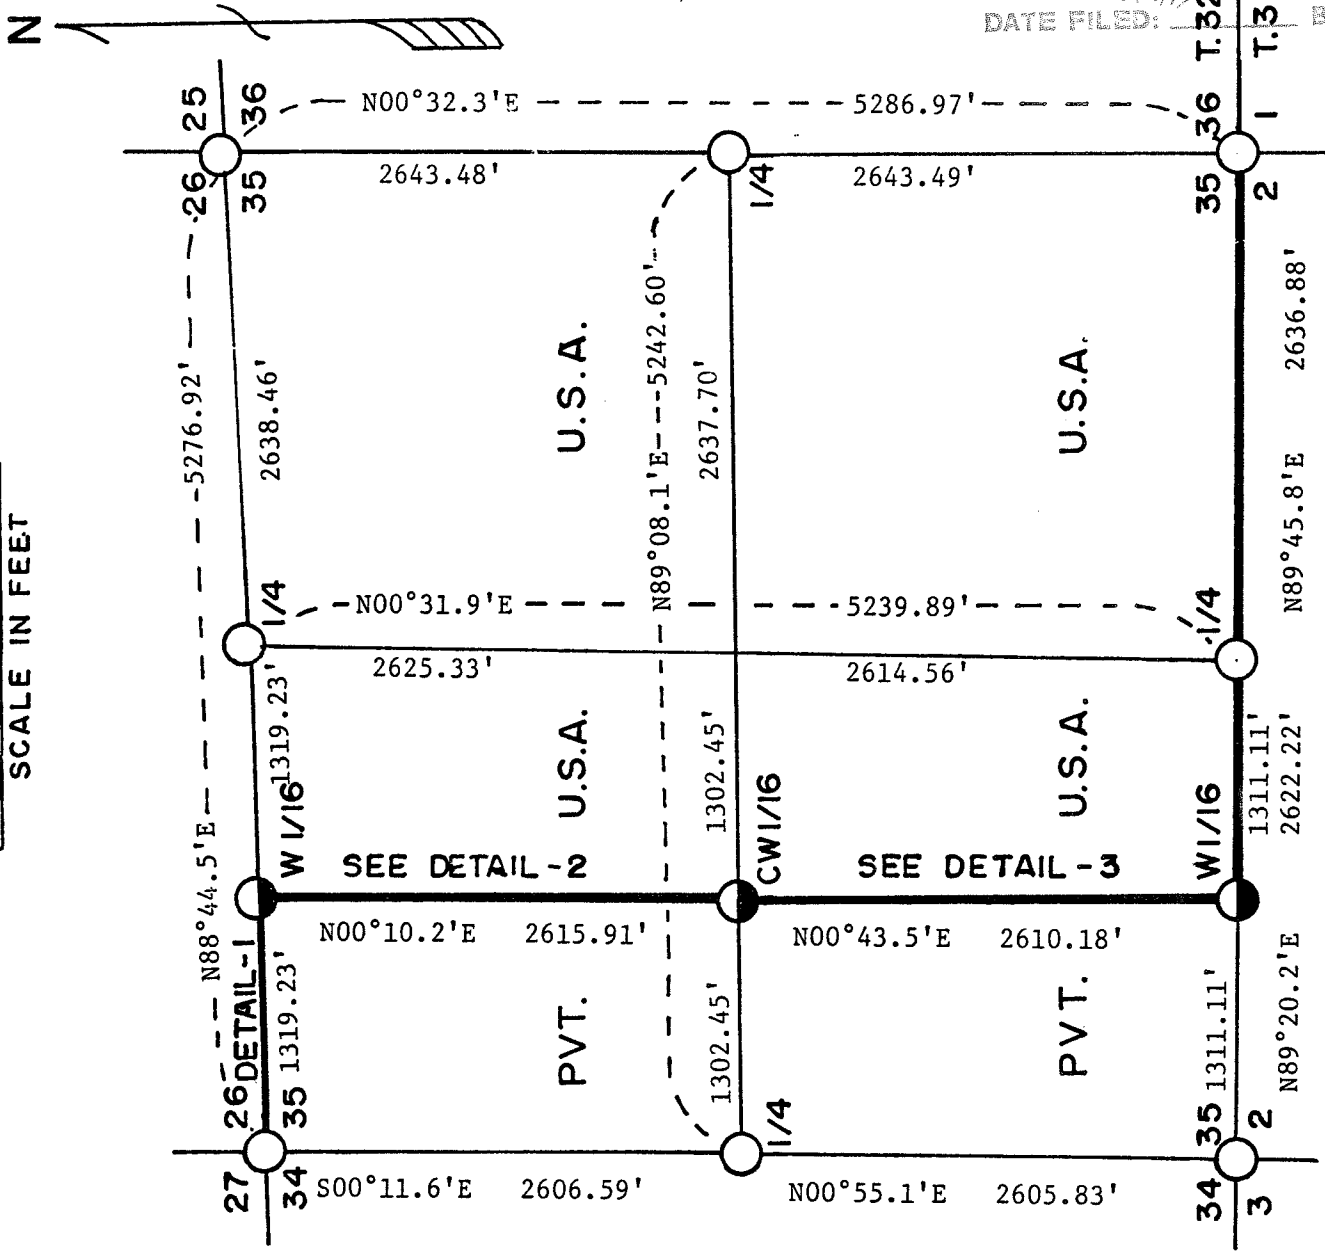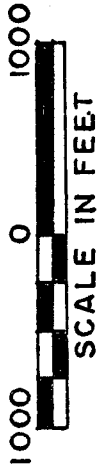


LEGEND

- Set Forest Service Aluminum Monument 1" x 36"
- Found Forest Service Aluminum Monument
- Boundary U.S. Government Lands


RECORD # 10355
LANGLADE COUNTY SURVEYORS OFFICE
DATE FILED: 12/7/93 BY: DT

Conversion Factors:
Feet to Meters ~ 3.28083
Meters to Feet ~ 0.30480


DETAIL-1

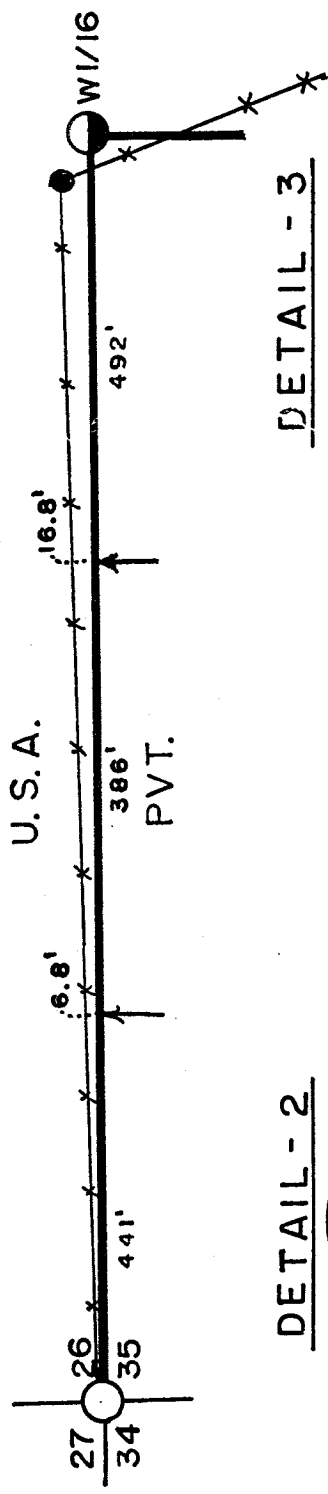

DETAIL - 2

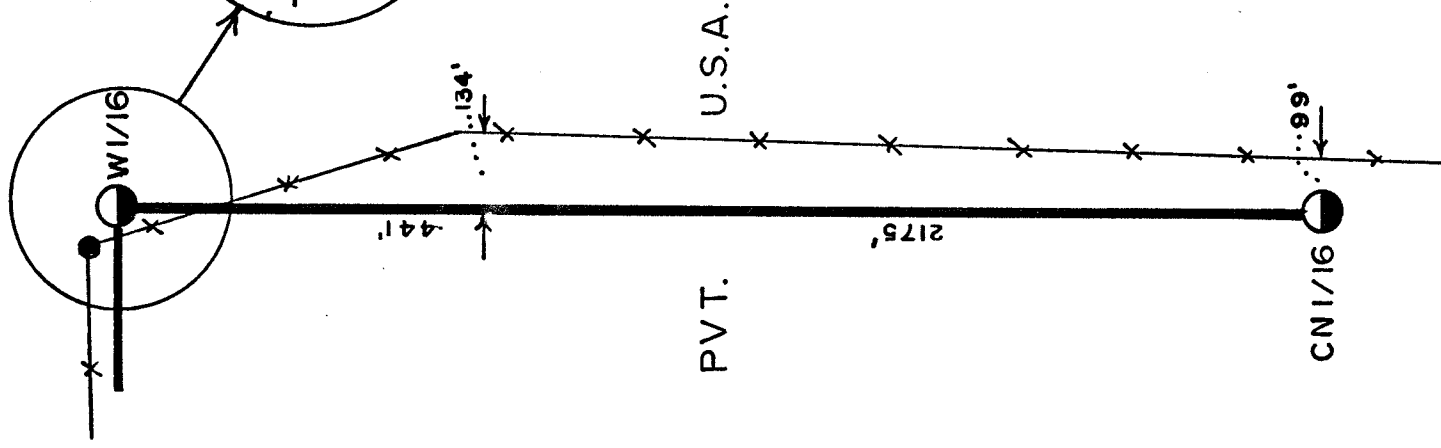

DETAIL - 3

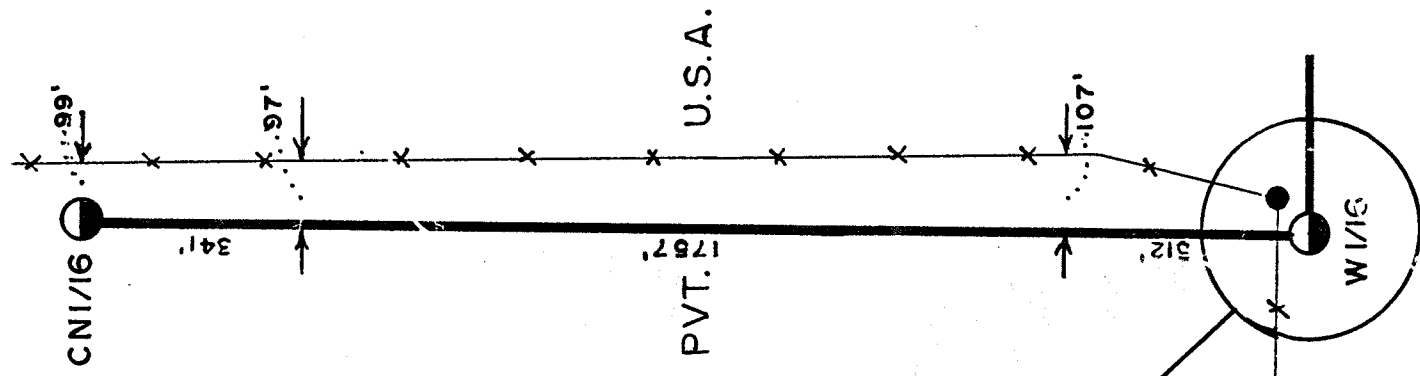

SURVEY NOTES

This survey was made at the request of the U. S. Department of Agriculture, Forest Service, under contract #53-56A6-8-00187 dated June 3, 1988 to Milo E. Stefan, a registered land surveyor in the State of Wisconsin. The purpose of the survey was to establish and mark controlling subdivision corners and boundaries of U. S. Government Lands in Section 35, Township 32 North, Range 14 East.

The original government subdivision survey of this township was made in 1857 by Alfred Millard. The south boundary in 1857 by Armetus Curtis. A corner restoration project by the Forest Service in 1987 and 1988 restored the corners for the control to subdivide this section.

The U. S. Government acquired title to lands in this section in 1934. The control survey for this survey was furnished by the Forest Service. True bearings and distances were provided the contractor. The field notes and a copy of this plat are on file in the Forest Supervisor's Office in Rhinelander, Wisconsin. A copy of the "plat of Survey" is on file in the District Ranger's Office at Lakewood, Wisconsin.

CORNERS RECOVERED

- ✓-17 1. Section Corner Common to Sections 26, 27, 34 and 35; T32N, R14E.
Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
- ✓-21 2. Section Corner Common to Sections 25, 26, 35 and 36; T32N, R14E.
Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
- 2-17 3. Section Corner Common to Sections 2, 3, 34 and 35; T31 & 32N, R14E.
Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
- 2-21 4. Section Corner Common to Sections 1, 2, 35 and 36; T31 & 32N, R14E.
Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
- ✓-19 5. Quarter Corner to Sections 26 and 35; T32N, R14E.
Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
- ✓-17 6. Quarter Corner to Sections 34 and 35; T32N, R14E.
Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
- ✓-21 7. Quarter Corner to Sections 35 and 36; T32N, R14E.
Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.
- 2-19 8. Quarter Corner to Sections 2 and 35; T31 & 32N, R14E.
Corner monument recovered in place and as described on the "U. S. Public Land Corner Monument Record" on file with the Langlade County Land Surveyor.

CORNERS ESTABLISHED

V-18 1.

West Sixteenth Corner Between Sections 26 and 35.
Position established on line and at midpoint between the North Quarter Corner and Northwest Section Corner of Section 35. Position marked by a 1" x 36" drive type aluminum monument with tablet stamped to identify corner.

Corner references:

6"	Red Maple	S80°E	37.36 Feet
6"	Red Maple	S7°W	7.10 Feet
	Steel Sign Post	South	1.0 Feet
	Fence Corner Bears	N53°W	31.5 Feet

Z-18 2.

West Sixteenth Corner Between Sections 2 and 35, Townships 31 and 32 North, Range 14 East.

Position established on line and at midpoint between the South Quarter Corner and Southwest Section Corner of Section 35. Position marked by a 1" x 36" drive type aluminum monument with tablet stamped to identify corner.

Corner references:

6"	Cedar	N21°E	11.61 Feet
4"	Cedar	S67°W	11.87 Feet
	Steel Sign Post	East	1.1 Feet
	Fence Corner	N33°E	70.15 Feet

X-18 3.

Center West Sixteenth Corner to Section 35.

Position established on line and at midpoint between the West Quarter Corner and Center Quarter Corner of Section 35. Position marked by a 1" x 36" drive type aluminum monument with tablet stamped to identify corner.

Corner references:


9"	Sugar Maple	N36°E	7.61 Feet
10"	Sugar Maple	S69°W	6.28 Feet
	Steel Sign Post	North	.9 Feet

SURVEYOR'S AFFIDAVIT

State of Wisconsin) ss
County of Langlade)

I, Milo E. Stefan, a Registered Land Surveyor in the State of Wisconsin, hereby certify that I have surveyed and marked the boundaries to Forest Service lands in Section 35, Township 32 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and survey notes herein are a correct representation of the land surveyed and boundaries marked. I have surveyed and posted the boundaries in said sections in accordance with the rules for survey of the public lands and with the statutes of the State of Wisconsin.

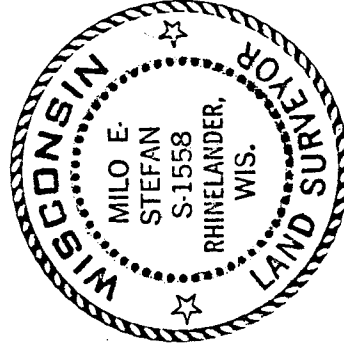

Milo E. Stefan
Milo E. Stefan
Registered Land Surveyor S-1558
State of Wisconsin
Date of Survey: June 1988

Darryl Stefan
District Ranger
Plat Ready for Filing: 8/4/88
Date