

LANGLADE COUNTY
U.S. PUBLIC LAND CORNER RESTORATION

The Center of Section 6, T. 31 N., R. 11 E., Langlade County, WI.

Corner was: (check all that apply)

- ☐ Restored through acceptance of an obliterated evidence location.
☒ Restored through acceptance of a found perpetuated location.
☐ Determined to be lost and re-established through proportionate methods.
☐ Show bearings and distances to PLSS corners used for proportioning, and show original distances).
☐ Restored/recovered/re-established in a location that differs from a previously established position.
☐ (Show difference in plan view below).
☐ Check here if additional information is shown on the reverse side of this form.

4311106 2020

Describe record evidence, recovered physical evidence, occupational evidence, testimonial evidence and all other evidence considered in the recovery/restoration of the corner.

This corner was not monumented in the original government survey.

1894 Joseph Duchac (map 10460) set a single bit axe and cedar post for the corner. Webley (no date) FB130, Pg. 4, ran south from "cent. Post" to S1/4 post and had distance of 40 chains to N1/4 corner. 1938 Malcom Hutchinson, in FB122, Pg. 150: "Center of sec. Found pipe in road for cor." Kelly, on a 1989 map (map 30289) shows "nail set over existing iron in road". 09/25/1992 I found a PK nail in the road. I set short ties, removed the nail, then dug. At 15", found the top of a bent, 1-1/4" x 26' iron pipe. Kellys nail is directly above the bent portion of iron pipe. I dug further and found the bottom 16" of the pipe was straight and upright. The straight portion of the pipe found was accepted as the best evidence of the corner mentioned by Hutchinson. I removed the pipe and at the position of the straight portion of pipe found, I set a 3/4" x 30" rebar, top of which is 19" below the road surface. This location is 6" east of Kellys location. 10/15/25 From the short ties, I set a MAG nail for the corner and set ties as shown.

Physical description of the monument set:

MAG nail set over previously found iron pipe


Describe the accessories used to perpetuate the corner. Include a plan view drawing and accessories found/set. Describe measuring point on bearing trees. Show any topographic features that would aid in future recovery of the corner.

LEGEND

- O 3/4" (ID) x 18" iron pipe set or as noted
T white vinyl sgln post set

Bearings are Langlade County
Coordinate system grid bearings

Field book: FB 3-86

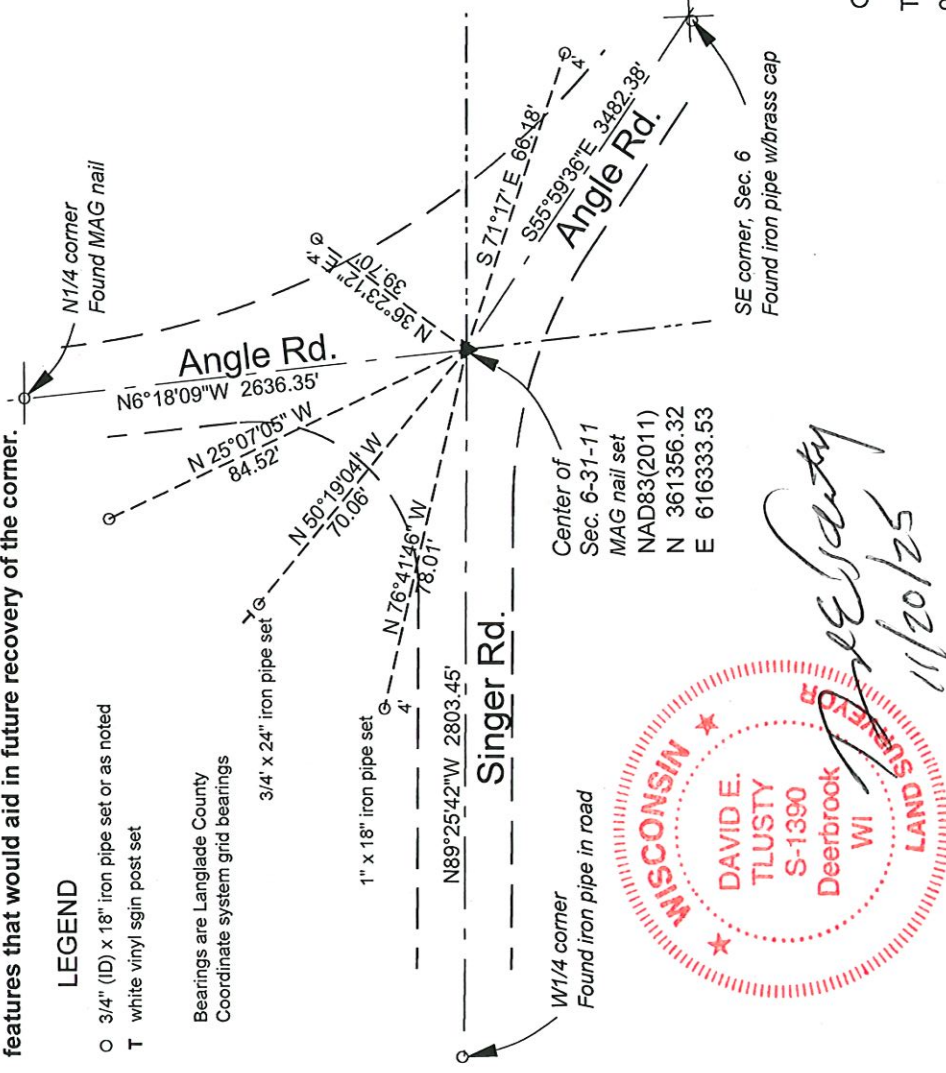

Index No.

C3 31-11

O = corner perpetuated

The Center
of Section 6,
T. 31 N., R. 11 E.,
Langlade County, WI

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.