

43410 07 3800 2025

# U S PUBLIC LAND SURVEY MONUMENT RECORD

NOTE: This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a-i)

A-E 7.08(3)(a) Identity of corner:  
MEANDER CORNER  
EAST LINE OF SECTION 07,  
TOWNSHIP 34 NORTH,  
RANGE 10 EAST OF THE 4TH PM,  
TOWN OF ELCHO, COUNTY OF LANGLADE

WISCONSIN - LANGLADE COUNTY  
N: 454,928.142 USft (XXX,XXX.XXX)  
E: 587,582.794 USft (XXX,XXX.XXX)  
Datum: NAD83 (2011)  
GNSS Method RTK  
GNSS Control WISCONSIN VRS

The coordinate value shown has been verified by the average of two or more GPS observations at a markedly different time. Coordinates shown in parenthesis are previously published values.

A-E 7.08(3)(b)

Original Surveyor: J. L. Nowlin

Date of Original Survey    Commenced:    July 8, 1865  
Completed:    July 20, 1865


Original Accessories:  
Tamarac    4    S 25° E    15 Links  
Tamarac    5    S 65° W    30 Links

See previous U.S. Public Land Corner Restoration - E-F-5 34-10 - October 22, 2007 - Surveyor 1390 - David E. Tlusty.

THENCE:

March 14, 2023 - I found what I believe to be a 4" diameter pipe with a brass cap affixed to the top. The monument is near the south shore of a small pond, and located in the water, ±5 feet from shore & ±12 inches below the water surface. NOTE: I could not see the monument, but I could touch it with my fingers. I also found 2 bearing tree witnesses (of no record), and a white vinyl T-post. I established 2 new reference monuments as shown below.

A-E 7.08(3)(c)(d) Plan view of corner with references to at least 4 witness monuments.

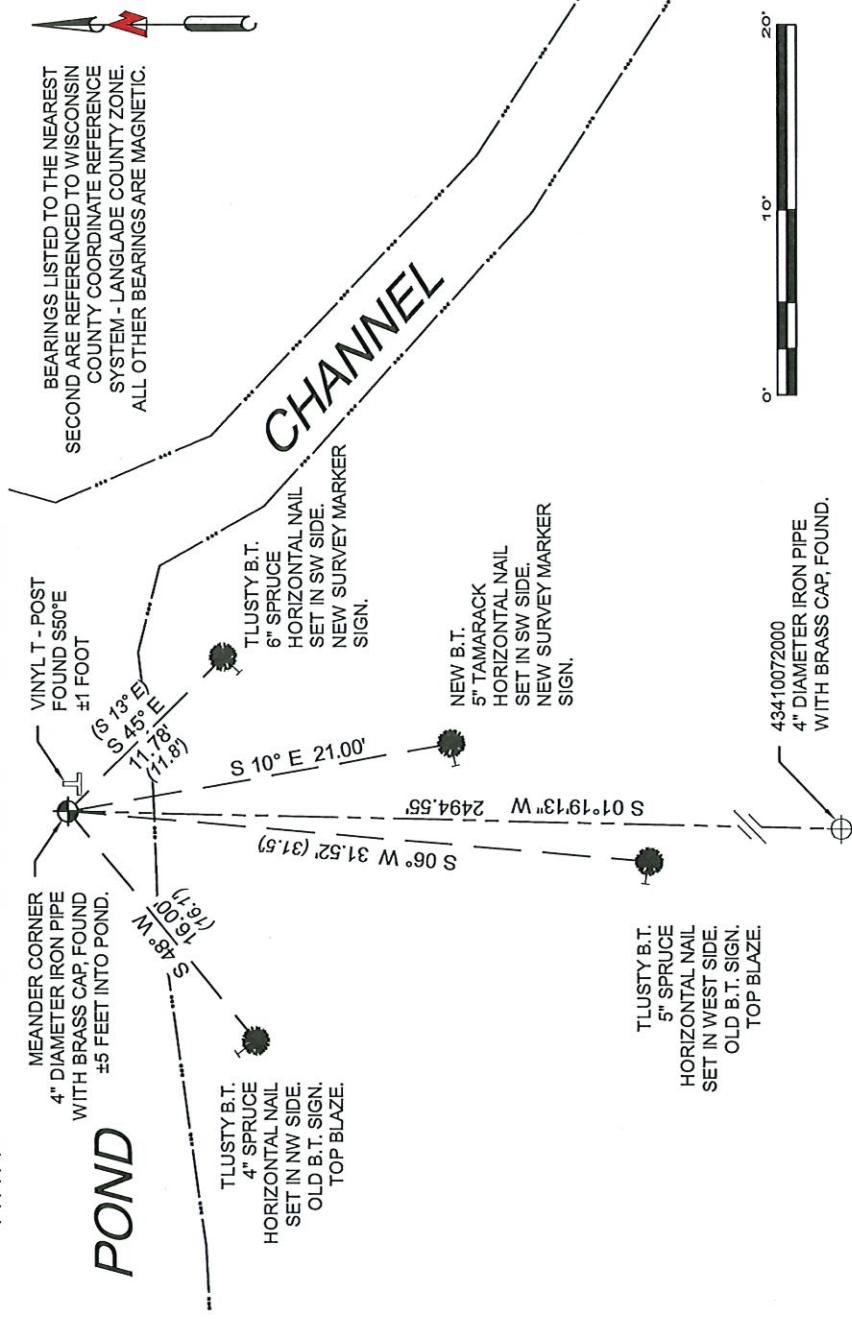

A-E 7.08(3)(e) 1865 Surveyor set a post, 1939 Surveyor set a 4" boiler tubing filled with concrete, surmounted by a brass cap, on which is stamped the corner location, 2007 Surveyor found the same, as did I in 2023.

A-E 7.08(3)(f) I accept this monument as a FOUND PERPETUATED LOCATION of the corner.  
A-E 7.08(3)(g)(h) This corner was not determined through lost-corner-proportionate methods.

A-E 7.08(3)(i) I, Jeffrey L. DeMuth, Professional Land Surveyor No. S-2656, hereby certify that the corner location on this record was determined by me or under my direction and control, and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge, and belief.



SIGNATURE

March 22, 2023  
Revised 08/22/25

DATE

Accepted the monument found as the best evidence of the original corner location.

I, David E. Tlusty, Registered Land Surveyor, as Langlade County Surveyor, certify that the corner location on this record was determined by me and that this U.S. Public Land Survey Monument Record is correct to the best of my knowledge and belief.