


Stock No. 26273

PLAT OF SURVEY
U.S. GOVERNMENT LAND
Being the NE1/2 and SW1/4, NE1/4, SE1/2 and NW1/4, SE1/4; NE1/4,
NW1/4; and Government Lots 2 and 3, Section 3
Township 33 North, Range 14 East, Fourth Principal Meridian
LANGLADE COUNTY, WISCONSIN

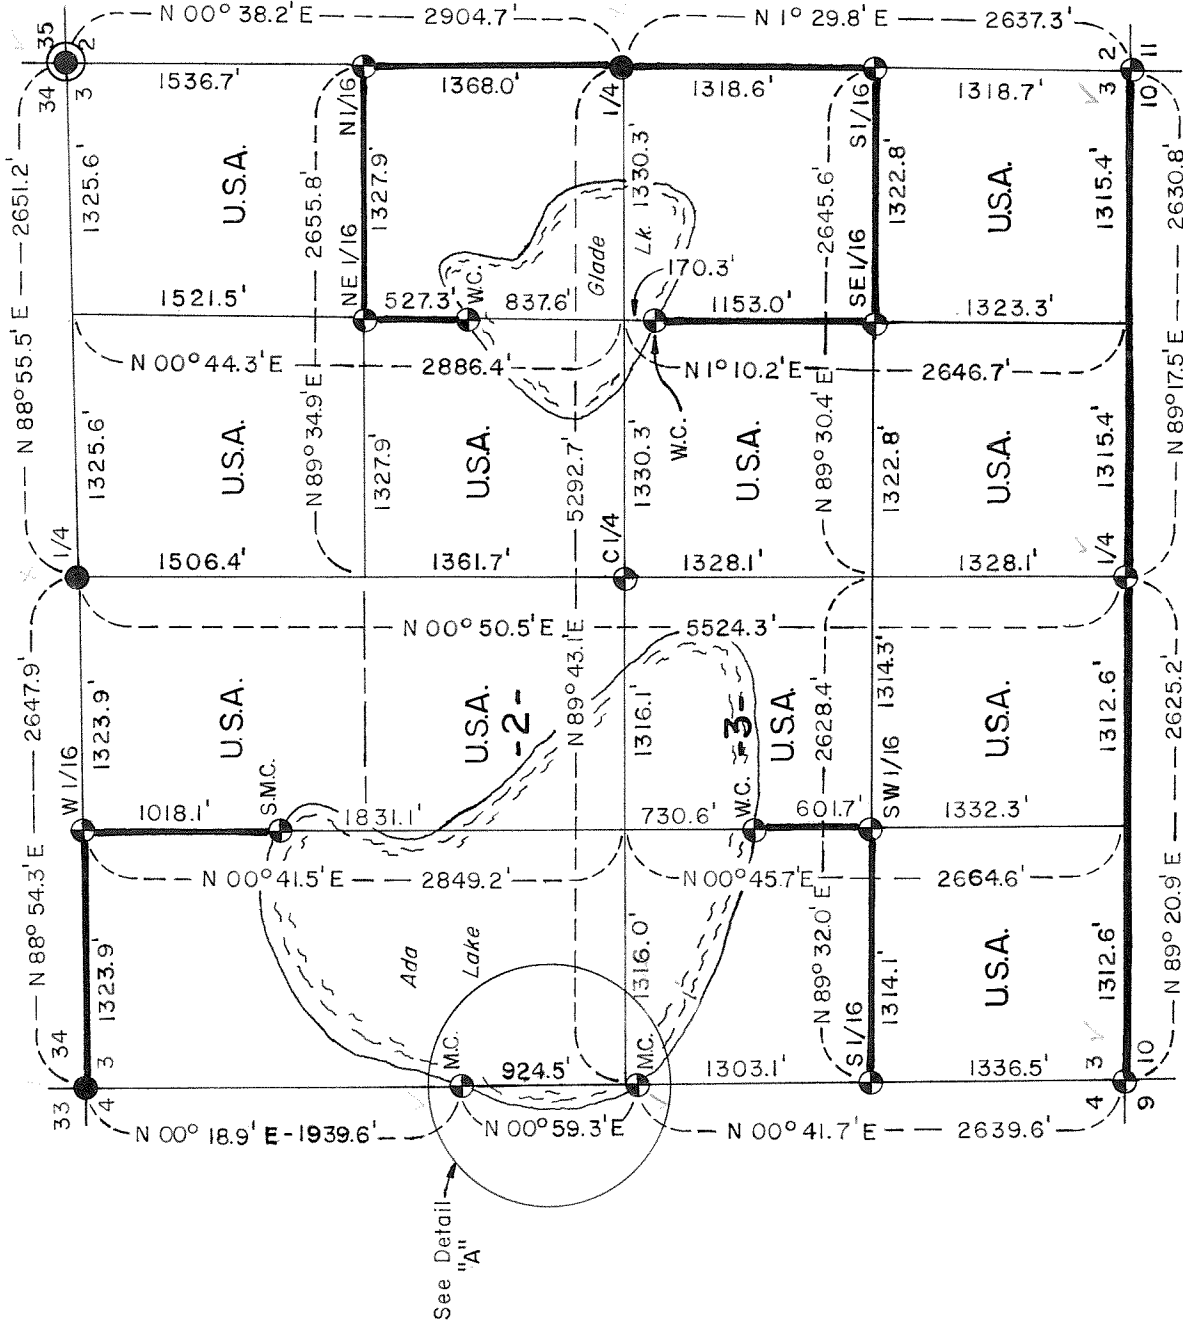


LEGEND

- 2" Iron Pipe with Brass Cap.
- ⊙ 2" x 36" Aluminum Monument with Aluminum Cap.
- ⊙ Corner Marked by "X" on Large Rock.
- Marked Boundary Line of U.S. Government Lands.



RECORD # 10141
LANGLADE COUNTY SURVEYORS OFFICE
DATE FILED: 6/9/93 BY: D. TUSTY

Stock No. 26273

DETAIL "A"



Ada Lake

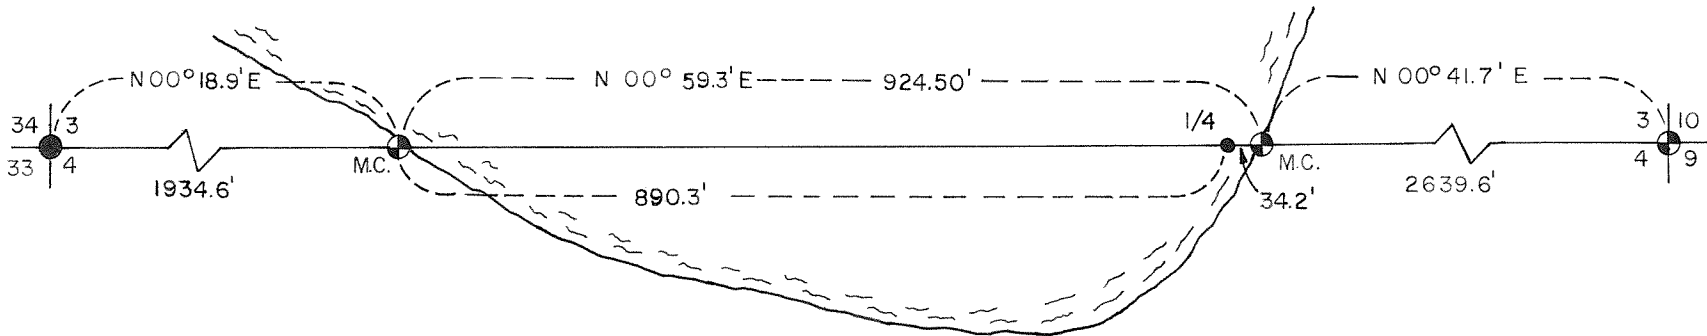

Stock No. 26273

SURVEY NOTES

This survey was made by the U. S. Department of Agriculture, Forest Service, for the purpose of restoring and establishing corners on the perimeter of Section 3, for establishing subdivisinal corners within Section 3, and for locating and marking the boundaries of U. S. Government land on their perimeter and within Section 3, Township 33 North, Range 14 East, Fourth Principal Meridian, Langlade County, Wisconsin.

The U. S. Government lands in this section were acquired in 1942.

The original Government subdivision survey of this township was made in 1865. The north town line was made in 1857.

The corner positions recovered, restored, and established by this survey are marked by the monument described in the map legend.

The corner positions established were located to an accuracy of one part in 3000.

The bearings between corner positions are true bearings as determined by solar observations.

The field notes of this survey and a copy of this plat are on file in the Forest Supervisor's Office at Rhinelander, Wisconsin.

CORNERS RECOVERED AND RESTORED

- A-17
1. Corner Common to Sections 2-3-34-35, T.33-34N., R.14E.
Corner restored at the intersection of lines between the north quarter of Section 3 and north quarter of Section 2 and the east line of Section 3 from the east quarter through the north sixteenth corner.
Corner References:

2" x 36" Aluminum Monument	East	5.70 feet
Sugar 5"	N.58°E.	6.46 feet
Sugar 8"	N.20°W.	22.68 feet
Steel Sign Post	Northeast	1.50 feet
2" x 36" Aluminum Monument	South	4.62 feet
Sugar 7"	S.4°W.	9.02 feet
Sugar 12"	S.85°W.	20.16 feet
Steel Sign Post	Southwest	1.10 feet

- E-17
2. Corner Common to Sections 2-3-10-11, T.33N., R.14E.
Corner position found marked by a scribed wood post with an older wood post alongside. This is the best available evidence of this corner position.
Corner References:

Sugar 5"	N.13°E.	22.70 feet
White Ash 9"	S.75°E.	29.56 feet
White Ash 11"	S.23°W.	44.18 feet
Yellow Birch 9"	N.73°W.	23.02 feet
Steel Sign Post	South	1.30 feet

Stock No. 26273

SHEET 4 of 7

- E-13** 3. Corner Common to Sections 3-4-9-10, T.33N., R.14E.
 Corner position found marked by a scribed wood post with an older wood post alongside. This is the best available evidence of the corner position.

Corner References:

Bitter Hickory	7"	N.12°E.	25.74	feet
Sugar	6"	S.60°E.	31.24	feet
Sugar	14"	S.78°W.	38.23	feet
Sugar	20"	N.40°W.	50.75	feet
Steel Sign Post		South	1.70	feet

- A-13** 4. Corner Common to Sections 3-4-33-34, T.33-34N., R.14E.
 Corner Restoration Certificate on file--Document No. 202744.

- C-17** 5. Quarter Corner Common to Sections 2-3, T.33N., R.14E.
 Corner Restoration Certificate on file in Langlade County Surveyor's Office.

- E-15** 6. Quarter Corner Common to Sections 3-10, T.33N., R.14E.
 Corner position found marked by scribed wood post and supported by blazed lines east and west. This is best available evidence of corner position.

Corner References:

Sugar	5"	S.39°E.	9.03	feet
Sugar	10"	S.58°W.	24.14	feet
White Ash	9"	N.52°W.	39.92	feet
Steel Sign Post		West	1.85	feet

- C-13** 7. Meander Corner South Shore of Lake Common to Sections 3-4, T.33N., R.14E.
 Corner position found marked by a 2" iron pipe and scribed wood post from which the remains of the original BTs fit.

Corner References:

Hemlock	10"	S.22°E.	23.16	feet
Hemlock	14"	S.72°W.	13.05	feet
Hemlock	12"	N.37°W.	23.00	feet
Steel Sign Post		East	1.70	feet

- BC-13** 8. Meander Corner North Shore of Lake Common to Sections 3-4, T.33N., R.14E.
 Corner position found marked by a 2" iron pipe and wood post.

Corner References:

Hemlock	20"	N.19°E.	35.64	feet
Hemlock	9"	S.81°W.	55.47	feet
Sugar	10"	N.74°W.	71.02	feet
Steel Sign Post		Northwest	3.60	feet

- A-15** 9. Quarter Corner Common to Sections 3-34, T.33-34N., R.14E.
 Corner Restoration Certificate on file--Document No. 111428.

CORNERS ESTABLISHED

- C-15** 1. Center Quarter to Section 3, T.33N., R.14E.
 Corner established at the intersection of the one-quarter lines of Section 3.

Corner References:

Sugar	6"	N.2°W.	31.91	feet
Sugar	6"	S.82°E.	6.10	feet
White Ash	10"	N.71°W.	6.53	feet
Steel Sign Post		Southeast	1.60	feet

Stock No. 26273

SHEET 5 of 7

- B-17 2. North One-Sixteenth to Sections 2-3, T.33N., R.14E.
Corner position found marked by 2" iron pipe and wood post. Position fits well with intersection of town line and proportional distance north and south.
Corner References:
- | | | | | |
|-----------------|-----|---------|-------|------|
| White Ash | 14" | S.81°E. | 22.12 | feet |
| Sugar | 5" | S.46°W. | 5.25 | feet |
| Sugar | 11" | N.41°W. | 16.49 | feet |
| Steel Sign Post | | West | 1.60 | feet |
- D-17 3. South One-Sixteenth to Sections 2-3, T.33N., R.14E.
Corner established midpoint and on line between the southeast corner and the east quarter corner of Section 3.
Corner References:
- | | | | | |
|-----------------|-----|---------|-------|------|
| Sugar | 20" | S.36°E. | 24.10 | feet |
| White Ash | 11" | S.70°W. | 8.48 | feet |
| Yellow Birch | 9" | N.48°W. | 28.85 | feet |
| Steel Sign Post | | West | 2.05 | feet |
- D-13 4. South One-Sixteenth to Sections 3-4, T.33N., R.14E.
Corner established midpoint and on line between the southwest corner and the west quarter corner of Section 3.
Corner References:
- | | | | | |
|-----------------|----|---------|-------|------|
| Sugar | 8" | N.38°E. | 9.40 | feet |
| Basswood | 8" | S.15°E. | 33.44 | feet |
| Sugar | 9" | S.65°W. | 44.78 | feet |
| Steel Sign Post | | East | 1.60 | feet |
- A-14 5. West One-Sixteenth to Sections 3-34, T.33-34N., R.14E.
Corner established midpoint and on line between the northwest corner and the north quarter corner of Section 3.
Corner References:
- | | | | | |
|-----------------|----|---------|-------|------|
| Sugar | 8" | S.61°E. | 5.83 | feet |
| Sugar | 5" | S.13°W. | 35.01 | feet |
| Sugar | 5" | N.11°W. | 2.99 | feet |
| Steel Sign Post | | South | 1.30 | feet |
- B-16 6. Northeast One-Sixteenth to Section 3, T.33N., R.14E.
Corner established at the intersection of the north and east one-sixteenth lines of Section 3.
Corner References:
- | | | | | |
|-----------------|-----|---------|-------|------|
| Red Oak | 10" | N.70°E. | 13.76 | feet |
| Sugar | 10" | S.49°W. | 6.31 | feet |
| Sugar | 5" | N.35°W. | 34.33 | feet |
| Steel Sign Post | | East | 1.80 | feet |
- D-16 7. Southeast One-Sixteenth to Section 3, T.33N., R.14E.
Corner established at the intersection of the south and east one-sixteenth lines of Section 3.
Corner References:
- | | | | | |
|-----------------|-----|---------|-------|------|
| Sugar | 5" | N.57°E. | 34.55 | feet |
| White Ash | 11" | S.72°E. | 8.69 | feet |
| Sugar | 6" | N.20°W. | 7.09 | feet |
| Steel Sign Post | | North | 1.50 | feet |

Stock No. 26273

SHEET 6 of 7

D-14

8. Southwest One-Sixteenth to Section 3, T.33N., R.14E.
 Corner established at the intersection of the south and west one-sixteenth
 lines of Section 3.
 Corner References:

Sugar	6"	N.66°E.	20.13 feet
Sugar	9"	S.48°E.	7.02 feet
White Ash	10"	S.24°W.	20.58 feet
Steel Sign Post		West	2.40 feet

BC-16

9. Witness Corner to Center East One-Sixteenth North Side of Glade Lake in
 Section 3, T.33N., R.14E.
 Corner established on the east sixteenth line 837.6 feet north of center
 east one-sixteenth.
 Corner References:

Hemlock	7"	N.5°E.	42.78 feet
Hemlock	6"	N.49°E.	55.80 feet
Red Maple	8"	S.79°W.	26.11 feet
Steel Sign Post		North	1.60 feet

CT-16

10. Witness Corner to Center East One-Sixteenth South Side of Glade Lake in
 Section 3, T.33N., R.14E.
 Corner established on the east sixteenth line 170.3 feet south of center
 east one-sixteenth.
 Corner References:

Red Maple	8"	N.72°E.	3.58 feet
Red Oak	5"	S.38°E.	24.38 feet
Hemlock	22"	S.68°W.	6.86 feet
Steel Sign Post		South	3.90 feet

CD-14

11. Witness Corner to Center West One-Sixteenth South Side of Ada Lake in
 Section 3, T.33N., R.14E.
 Corner established on the west sixteenth line 730.6 feet south of the
 center west one-sixteenth.
 Corner References:

Hemlock	12"	S.66°E.	10.09 feet
Hemlock	8"	S.21°E.	26.08 feet
Hemlock	7"	S.40°W.	29.73 feet
Steel Sign Post		North	1.00 feet

AG-14

12. Special Meander Corner North Side of Ada Lake in Section 3, T.33N., R.14E.
 Corner established at the intersection of the west sixteenth line and the
 north shore of Ada Lake 1018.1 feet south of the west one-sixteenth on the
 north section line of Section 3.
 Corner References:

White Pine	13"	N.46°E.	9.80 feet
Hemlock	5"	N.61°W.	13.90 feet
White Pine	14"	N.4°W.	15.70 feet
Steel Sign Post		North	1.40 feet

Stock No. 26273

SHEET 7 of 7

SURVEYOR'S AFFIDAVITState of Wisconsin] SS
County of Langlade]

I, Milo E. Stefan, Cadastral Surveyor, U. S. Forest Service, and a registered surveyor in the State of Wisconsin, hereby certify that I have surveyed and subdivided Section 3, Township 33 North, Range 14 East, Fourth Principal Meridian, State of Wisconsin.

The plat map and the notes herewith are a correct representation of the land surveyed and divided. I have surveyed and subdivided said section in accordance with the rules for survey of the public lands and with the statutes of the State of Wisconsin.



Milo E. Stefan
Cadastral Surveyor, U. S. Forest Service
R. L. S., State of Wisconsin
Certificate S-1558

Date of Survey: 1982